

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

week 3 - 2017

Alert number: A12/0041/17

Product: Sandals

Name: Unknown

Risk: Chemical

Category: Clothing, textiles and fashion items

Brand: Philov' (by Chaussea)

Type/number of model: 512 000 05 S

Risk level: Serious risk

The metal rivets release an excessive amount of nickel (measured value: 1.2 µg/cm²/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product does not comply with the REACH Regulation.

Measures taken by economic operators: Destruction of the product, Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Ladies' sandals, flip-flop style with a cross-strap decorated with plastic flowers attached by metal rivets. Available in black, white, fuchsia, blue and navy. Sample size 37.

Batch number/Barcode: Unknown

Country of origin: China

Alert submitted by: France



Alert number: A12/0053/17

Product: Children's sweatshirt

Name: 1) Y Core Cotton Hoodie; 2) JR Flame Hoodie

Risk: Strangulation

Category: Clothing, textiles and fashion items

Brand: Wilson

Type/number of model: 1) WRE220010, WRE220012; 2) WRE220011

Risk level: Serious risk

The drawstring with free ends in the hood may become trapped during various activities of a child, posing a risk of strangulation. The product does not comply with the relevant European standard EN 14682.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Hooded sweatshirt for children with a drawstring in the hood and a kangaroo pocket on the front, ribbed hem and cuffs. Colours: black, peony and blue. Sizes: XS to XL.

Batch number/Barcode: Unknown

Country of origin: Bangladesh

Alert submitted by: Finland



Alert number: A12/0051/17

Product: Hair conditioner

Name: Original Formula - anti-dandruff hair and scalp conditioner

Risk: Chemical

Category: Cosmetics

Brand: Sulfur 8

Type/number of model: Reorder#432-1 L4321

Risk level: Serious risk

The conditioner contains triclosan, which is not authorised in leave-on cosmetic products. The products do not comply with the Cosmetic Products Regulation.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: Hair conditioner supplied in a cylindrical 205g pot with a yellow screw-top lid. To be applied to without rinsing.

Batch number/Barcode: 075610432107; lot : 13TJ 14280

Country of origin: United States

Alert submitted by: France



Alert number: A12/0024/17

Product: Heated pet pad

Name: Unknown

Risk: Burns, Fire

Category: Electrical appliances and equipment

Brand: Chang Sheng

Type/number of model: C-002

Risk level: Serious risk

The pad had not been fitted with any cut-outs or thermal fuses to protect against thermal overload or other overheating. The supply cord conductor cross sectional area is inadequate and the plug supplied not suitable for UK use. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN EN 60335.

Measures taken by economic operators: Withdrawal of the product from the market (By: Retailer)

Description: Heated pet pads, voltage rating 220V, size 450mm x450mm enclosing electrical heating elements in thermal insulation. The outer fabric is waterproof. The element is controlled by an in-line switch with two settings full or half on and connected to the mains via a North American style two pin plug, includes a three pin adapter plug supplied separately.

Batch number/Barcode: 6937532900130. Item ID: 381786036329.

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/0025/17

Product: Mains extension lead

Name: Unknown

Risk: Electric shock

Category: Electrical appliances and equipment

Brand: Electraline

Type/number of model: 59650, FRP020914-1

Risk level: Serious risk

The power rating shown is not correct and the clearance distances are too small. This could lead to accessible parts becoming live. The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Mains extension lead with four socket outlets.

Batch number/Barcode: 3390723596506

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0043/17

Product: USB Charger

Name: 4-port USB Quick Charger

Risk: Electric shock

Category: Electrical appliances and equipment

Brand: Logilink

Type/number of model: PA0062

Risk level: Serious risk

The clearance /creepage distances between the primary and secondary windings in the main transformer are not sufficient. Live parts can be accessible which can lead to an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60065.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market

Description: 4-port USB Charger. Sold in a transparent package. Electrical specifications: Input: 110-240 VAC, 50-60 Hz, class II Output: 5.0 VDC, Max. 2.5 A.

Batch number/Barcode: 4052792015683

Country of origin: China

Alert submitted by: Finland



Alert number: A12/0060/17

Product: Earrings

Name: NAUŠNICE ('Earrings')

Risk: Chemical

Category: Jewellery

Brand: Unknown

Type/number of model: Art. 012491

Risk level: Serious risk

The product contains lead (measured value: 34.1 %). Exposure to lead is harmful for human health. The product does not comply with the REACH regulation.

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures

Description: Pair of earrings with yellow plastic pearl, in transparent packaging.

Batch number/Barcode: 1000000022841

Country of origin: China

Alert submitted by: Croatia



Alert number: A12/0055/17

Product: Lighting chain

Name: LED Rattan Light

Risk: Electric shock

Category: Lighting chains

Brand: Moniko

Type/number of model: Charger model: LY-0610

Risk level: Serious risk

The electrical insulation between the input and output circuits of the charger is inadequate. The internal wires are not adequately secured and could detach reducing the creepage distances and clearances. The product is not fitted with a means for overload or short circuit protection. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: LED lighting chain, 3 metres long, with controller unit, supplied with 2 pin charger and 3 pin travel plug adaptor. Packaged in cardboard box.

Batch number/Barcode: X000L693SV

Country of origin: Hong Kong

Alert submitted by: United Kingdom



Alert number: A12/0026/17

Product: LED floodlight

Name: LED Valonheitin 30W

Risk: Electric shock

Category: Lighting equipment

Brand: FTLight

Type/number of model: 6603045

Risk level: Serious risk

The cable temperature resistance is not sufficient in cold temperatures. Cable movement may cause cracks in the cable sheath and live parts could become accessible which can lead to an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598 and EN 61347.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market

Description: LED flood light, sold in a white cardboard box. Electrical specifications: DS-30W, 230V, 50Hz, class I, IP65.

Batch number/Barcode: Unknown

Country of origin: China

Alert submitted by: Finland



Alert number: A12/0038/17
Product: LED spot light
Name: LED Spot Light
Risk: Electric shock
Category: Lighting equipment
Brand: Unknown
Type/number of model: CPS-DP-GU10-04/KY216730150511
Risk level: Serious risk

The spotlight has insufficient insulation between accessible parts and live parts. It can be easily opened by hand without tools, in a way that live parts become accessible while the spotlight remains intact. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 62560.

Measures ordered by public authorities: Recall of the product from end users

Description: LED Spot light (LED lamp). Sold in a white cardboard box on which a marking plate and an energy label are attached.

Batch number/Barcode: Unknown

Country of origin: China

Alert submitted by: Finland



Alert number: A12/0049/17
Product: Nightlight
Name: LED Nightlight/ LED Energy Saving Night Light
Risk: Electric shock
Category: Lighting equipment
Brand: LIAN-LI/ HUAISHENG
Type/number of model: Bee: ISK-17657, HS-213, Elephant: ISK-15686, No.L815 , Owl: ISK-17661, No.L813
Risk level: Serious risk

The nightlight may be considered as a toy by a child. The child may pull it out of the socket and get an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Nightlights in three different forms: owl, elephant and bee. Packed in transparent plastic blister.

Batch number/Barcode: Bee: 69387537202138, Elephant: 2013101156864, Owl: 6880319176610

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0054/17
Product: LED floodlight
Name: Floodlight
Risk: Electric shock, Fire
Category: Lighting equipment
Brand: YCG

Type/number of model: Unknown
Risk level: Serious risk

The earth cable is not connected. The product is marked with an ingress protection rating but does not withstand water. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures ordered by public authorities: Recall of the product from end users

Description: LED floodlight with IR-sensor. Supplied in cardboard box.

Batch number/Barcode: Unknown

Country of origin: Unknown

Alert submitted by: Sweden



Alert number: A12/0027/17

Product: All-terrain vehicle

Name: Sportsman 570 Touring, Sportsman 570 UTE, Sportsman 570 Touring EPS, Sportsman 570 Touring SP, Sportsman 570 X2 & Sportsman 570 6x6

Risk: Fire

Category: Motor vehicles

Brand: Polaris

Type/number of model: Type Approval Numbers: E13*2002/24*0072*05, E13*2002/24*0258*03, E13*2002/24*0258*03, E11*2003/37*0306*01 and E8*167/2013*00001*00

Risk level: Serious risk

The air box intake snorkel may come in contact with the fuel rail or fuel line during operation. This could lead to a fuel leak that may pose a fire hazard.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: All-terrain vehicles

Batch number/Barcode: Vehicles built between 25 July 2013 and 29 September 2016.

Country of origin: United States

Alert submitted by: United Kingdom

Alert number: A12/0028/17
Product: Lorry / Bus
Name: R500 LA 4x2 / K 280 UB 4x2
Risk: Injuries
Category: Motor vehicles
Brand: Scania
Type/number of model: EC type-approval: E4*2007/46*0030*19, E4*2007/46*0031*19, E4*2007/46*0032*16, E4*2007/46*0038*19, E4*2007/46*0039*19, E4*2007/46*0040*15, E4*2007/46*0045*12, E4*2007/46*0046*17, E4*2007/46*0605*10 Type according to EC type-approval: N320, N321, N322, N330, N331, N332, N340, N341, N351
Risk level: Serious risk
Deviations in the steering arm contact surface with the steering connecting rod securing nut allow play between the steering connecting rod fastening nut and the steering arm, affecting the steering behaviour of the vehicle.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Lorry / bus
Batch number/Barcode: The vehicles concerned were manufactured in 2016.
Country of origin: Sweden
Alert submitted by: Germany

Alert number: A12/0029/17
Product: Bus
Name: Setra
Risk: Injuries
Category: Motor vehicles
Brand: Evobus
Type/number of model: Type: 633 04, 633 05 EC type-approval: e1*2007/46*0014, e1*2007/46*0018
Risk level: Serious risk
Due to incorrect welding, the hinges of the bonnet may break, with the risk of the bonnet coming loose and falling into the traffic area.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Bus
Batch number/Barcode: The vehicles concerned were manufactured between July 2016 and October 2016.
Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/0030/17
Product: Bus
Name: Intouro
Risk: Injuries
Category: Motor vehicles
Brand: Evobus
Type/number of model: Type: 633 01, EC type-approval: e1*2007/46*0012, sales description: Intouro, Intouro M, Intouro E, Intouro ME, Intouro M/L, Intouro L
Risk level: Serious risk
Since the collar fitted in assembly was too big, the generator cable may scrape on the bracket, and this may cause a short circuit, with the cable catching fire.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Bus
Batch number/Barcode: The vehicles concerned were manufactured between August 2005 and April 2016.
Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/0031/17

Product: Bus

Name: Citaro

Risk: Injuries

Category: Motor vehicles

Brand: EvoBus

Type/number of model: Type: 628 02, 628 03; authorisation number: e1*2007/46*0087, e1*2007/46*0090*

Risk level: Serious risk

Fracture of the square drive of the door shafts of the bi-fold, electric, in-swinging door may make it impossible to close the door once it has been opened. It cannot be ruled out that the door may be opened unintentionally, which would increase the risk of injury and accidents.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Bus

Batch number/Barcode: The vehicles affected were produced between November 2014 and July 2016.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0032/17

Product: Bus

Name: Citaro, O530G

Risk: Injuries

Category: Motor vehicles

Brand: Evobus

Type/number of model: Type: 628 02, 628 03; authorisation number: e1*2007/46*0087*, e1*2007/46*0090*

Risk level: Serious risk

Fracture of the square drive of the bi-fold, pneumatic, in-swinging door (with window heating) may make it impossible to close the door once it has been opened. It cannot be ruled out that the door may be opened unintentionally, which would increase the risk of injury and accidents.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Bus

Batch number/Barcode: The vehicles affected were produced between March 2013 and July 2016

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0033/17

Product: Bus

Name: Citaro

Risk: Injuries

Category: Motor vehicles

Brand: Evobus

Type/number of model: Type: 628 02, 628 03; authorisation number: e1*2007/46*0087*, e1*2007/46*0090*

Risk level: Serious risk

Fracture of the square drive of the bi-fold, pneumatic, in-swinging door may make it impossible to close the door once it has been opened. It cannot be ruled out that the door may be opened unintentionally, which would increase the risk of injury and accidents.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Bus

Batch number/Barcode: The vehicles affected were produced between October 2015 and August 2016.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0034/17

Product: Bus

Name: Citaro

Risk: Injuries

Category: Motor vehicles

Brand: EvoBus

Type/number of model: Type: 628 02, 628 03; authorisation number: e1*2007/46*0087*, e1*2007/46*0090*

Risk level: Serious risk

Fracture of the clamp screws of the actuating lever of the pneumatic, in-swinging door may make it impossible to close the door once it has been opened. It cannot be ruled out that the door may be opened unintentionally, which would increase the risk of injury and accidents.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Bus

Batch number/Barcode: The vehicles affected were produced in between June and December 2016.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0035/17

Product: Lorry

Name: Actros, Antos, Arocs

Risk: Injuries

Category: Motor vehicles

Brand: Mercedes-Benz

Type/number of model: Models: Actros 963, Antos 963, Arocs 964, EC type-approval: e1*2007/46*0726, *0727, *0728, *0729, *0730, *0731, *0732, *0733, *0734, *0735, *0736, *0737, *0738, *0740, *0741, *0742, type: 963003, 963004, 963005, 963020, 963021, 963022, 963024, 963025, 963403, 963403, 963404, 963405, 963406, 963406, 963420, 963422, 963423, 963424, 963425, 963426, 963427, 964002, 964003, 964007, 964014, 964016, 964020, 964022, 964024, 964026, 964030, 964031, 964041, 964200, 964203, 964207, 964214, 964216, 964218, 964224, 964230, 964238, 964241, 964330, 964341, 964402, 964403, 964407, 964408, 964414, 964416, 964418, 964420, 964423, 964424, 964426

Risk level: Serious risk

Incorrect steering spindles may have been fitted to the vehicles. As a result, the serration tooth flanks may not be sufficiently deep for the required transmission of power between the steering column and the steering spindle. In the worst-case scenario, the connection between the steering column and the steering spindle may slip, resulting in steering failure.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Lorry

Batch number/Barcode: The vehicles affected were produced between 26/09/2016 and 01/11/2016.

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: The Netherlands

Alert number: A12/0036/17

Product: Passenger car

Name: Series 2, Series 4, Series 5, Series 6, M4, M5, M6, X1, BMW i3, BMW i8, MINI

Risk: Injuries

Category: Motor vehicles

Brand: BMW

Type/number of model: EC type-approvals: e1*2007/46*0371, e1*2007/46*0316*, e1*2007/46*0377*, e1*2007/46*0215*, e1*2007/46*0508*, e1*2007/46*0363*, e1*2007/46*0455*, e1*KS07/46*0013*, e1*2007/46*0562, e1*2007/46*0361*, e1*2007/46*1676, e1*2007/46*1213*, e1*2007/46*1287*, e1*2007/46*1683, e1*2007/46*1680, e1*2007/46*1678, e1*2007/46*1679 types: UKL-L, 3C, M3, GT, K-N1, 5L, 5K, KL, 6C, M5/M6, F1X, BMWi-1, BMWi-2, FMK, FML4, FML2, FMCA

Risk level: Serious risk

The side, head and knee protection airbags of the front passenger seat may not work. This could increase the risk of injury to the occupant in the event of an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number/Barcode: The vehicles concerned were manufactured in 2016.

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: Ireland, Poland, The Netherlands

Alert number: A12/0037/17

Product: Passenger car

Name: F-Type & XE

Risk: Injuries

Category: Motor vehicles

Brand: Jaguar

Type/number of model: F-Type and XE (2017 model year) Type Approval Numbers: E11*2001/116*0272 and E11*2007/46*2150

Risk level: Serious risk

The front seatbelt pre-tensioner may fail to operate when required, increasing the risk of injury to front seat occupants in the event of a crash.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number/Barcode: Vehicles built between 16/02/2016 and 16/12/2016

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Ireland

Alert number: A12/0039/17

Product: Passenger car

Name: Range Rover, Range Rover Sport and Range Rover Evoque

Risk: Injuries

Category: Motor vehicles

Brand: Land Rover

Type/number of model: Range Rover and Range Rover Sport: 2016 and 2017 model year; Range Rover Evoque: 2017 model year. Type Approval Numbers: E11*2007/46*0649, E11*2007/46*0909 and E11*2007/46*0223.

Risk level: Serious risk

The front passenger airbag may fail to activate, increasing the risk of injury to front passenger seat occupants in the event of a crash.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger cars.

Batch number/Barcode: Vehicles built between 12/07/2016 and 26/10/2016.

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Slovakia

Alert number: A12/0040/17

Product: Passenger car

Name: Range Rover, Range Rover Sport and Discovery Sport

Risk: Injuries

Category: Motor vehicles

Brand: Land Rover

Type/number of model: Land Rover Range Rover (2016 and 2017 Model Year), Land Rover Range Rover Sport (2016 and 2017 Model Year) and Land Rover Discovery Sport (2017 Model Year). Type Approval Numbers: E11*2007/46*1659, E11*2007/46*0909 and E11*2007/46*1659

Risk level: Serious risk

The front seatbelt pre-tensioner may fail to operate when required, increasing the risk of injury to front seat occupants in the event of a crash.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number/Barcode: Vehicles built between 12/07/2016 and 26/10/2016.

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Ireland, Slovakia

Alert number: A12/0044/17

Product: Passenger car

Name: Macan

Risk: Injuries

Category: Motor vehicles

Brand: Porsche

Type/number of model: Type approval numbers: e13*2007/46*1165*02-07, e13*2007/46*1164*02-06 Types: 95B, 95BN

Risk level: Serious risk

Defective coupling rods of the front stabiliser can affect driving stability.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: The vehicles in question were manufactured between 30 July 2016 and 9 August 2016.

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: Poland, The Netherlands

Alert number: A12/0058/17

Product: Passenger car

Name: S60, S60CC, S60L, S90, V60, V60CC, XC60, XC90

Risk: Injuries

Category: Motor vehicles

Brand: Volvo

Type/number of model: Type-approval numbers: 9*2007/46*0023*21 - 25, e4*2007/46*1067*00, e9*2001/116*0068*23 + 24, e4*2007/46*0929*00 - 04 Types: F, P, KLAL, L

Risk level: Serious risk

The front passenger seat belt buckle can be incorrectly fastened, with the consequence that the buckle can separate from the seat belt clasp in the event of an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number/Barcode: The vehicles concerned were manufactured between 2015 and 2016.

Country of origin: Sweden

Alert submitted by: Germany

Products were found and measures were taken also in: Poland, The Netherlands

Alert number: A12/0023/17

Product: Gloves for sawing

Name: Chainsaw Gloves / Kettingzaag Handschoenen / Gants de tronçonnage

Risk: Cuts

Category: Protective equipment

Brand: OZAKI

Type/number of model: reference 9807811/10 (size 10) reference 9807811/12 (size 12) reference 9807811/11 (size 11)

Risk level: Serious risk

The gloves are not sufficiently resistant to cuts, which may result in severe injuries for the chainsaw user. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN 381-7.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Pair of gloves intended for protection during use of a chainsaw. Sold attached to a cardboard label

Batch number/Barcode: 3582321361185 (T10) 3582321362199 (T12) 3582321362137 (T11)

Country of origin: Pakistan

Alert submitted by: France



Alert number: A12/0021/17

Product: Toy scooter

Name: Trotтинettes 3 roues ('3-wheeled scooter')

Risk: Injuries

Category: Toys

Brand: MOOV'NGO

Type/number of model: MNG45 (for boys) and MNG44 (for girls) - SCO/110

Risk level: Serious risk

The steering tube can become detached if the child using the scooter pulls the handlebars upwards, which can cause the child to fall and get injured. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: Toy scooter with three wheels, two in the front and one behind. The scooter is packed in a cardboard box and intended for children from 2+.

Batch number/Barcode: Batch 15/006; bar codes 5420019721690 (model for boys) and 5420019721683 (model for girls)

Country of origin: China

Alert submitted by: France



Alert number: A12/0022/17

Product: Toy scooter

Name: Trotтинette 3 roues [3-wheeled scooter]

Risk: Entrapment, Injuries

Category: Toys

Brand: PLAY TIVE

Type/number of model: 103005

Risk level: Serious risk

There are accessible gaps between the wheels and the body of the scooter, which may result in the entrapment of fingers. Moreover, the scooter is not sufficiently stable, which may cause the child to lose balance and fall. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: 3-wheeled scooter, green with yellow handles; sold in a cardboard box (inscription: Delta Sport Hamburg D-22397)

Batch number/Barcode: TS-2113

Country of origin: Unknown

Alert submitted by: France



Alert number: A12/0042/17

Product: Soft toy

Name: Nilfisk Nile Toy Elephant

Risk: Choking

Category: Toys

Brand: Ibsens - Bamsefabrikken

Type/number of model: Item No. 2395

Risk level: Serious risk

The eyes of the toy can easily detach. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Soft toy elephant (33cm tall) with hard plastic eyes, dressed in a red shirt with 'Nilfisk' logo and blue trousers.

Batch number/Barcode: Unknown

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/0045/17

Product: Bath sponge

Name: Kids Bath Sponge

Risk: Choking

Category: Toys

Brand: OKS

Type/number of model: ref : 405591

Risk level: Serious risk

Small parts may be easily detached from the toy (foam eyes and legs) and a small child may put these in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Green and yellow bath sponge in the form of a crab.

Batch number/Barcode: 6944956090101

Country of origin: China

Alert submitted by: France



Alert number: A12/0046/17

Product: Soap bubble toy

Name: Unknown

Risk: Microbiological

Category: Toys

Brand: ZEEMAN

Type/number of model: Ref 60326

Risk level: Serious risk

The total count of aerobic mesophilic bacteria in the soap solution is too high (measured quantity 290000 cfu/ml), and *Pseudomonas aeruginosa* has been detected. There is a risk of contracting infections as the solution may come in contact with the mouth, hands and eyes. The product does not comply with the requirements of the Toy Safety Directive.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Soap bubble toy with accessories.

Batch number/Barcode: 8711197603265

Country of origin: China

Alert submitted by: France



Alert number: A12/0047/17

Product: Activity toy

Name: Cube d'activités

Risk: Choking

Category: Toys

Brand: SEQUOIA

Type/number of model: 1709480

Risk level: Serious risk

Small parts can easily be detached (wooden part at the back of the notched wheels). Small children may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Multi-activity cube comprising 4 sides of games: notched wheels, form fitter, abacus and circuit with shapes.

Batch number/Barcode: 2400017094807; lot 1709480

Country of origin: China

Alert submitted by: France



Alert number: A12/0048/17

Product: Toy scooter

Name: Disney Cars Scooter - Carbon Racer

Risk: Injuries

Category: Toys

Brand: SMOBY

Type/number of model: REF 750118

Risk level: Serious risk

The fork is fragile and can bend and break in the event of an impact, which might cause injuries to children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market

Description: Toy scooter with three wheels, two in the front and one behind. The scooter is packed in a cardboard box and intended for children from 2.5+ years.

Batch number/Barcode: 30321675011889; Lot 1603315A

Country of origin: China

Alert submitted by: France



Alert number: A12/0050/17

Product: Baby doll with accessories

Name: Doll Toys

Risk: Choking

Category: Toys

Brand: Ledy Toys

Type/number of model: 1.) Code 32606 (ref. 15060378, model LD9708B); 2.) code 32607, (ref. 1560381, model LD9708A)

Risk level: Serious risk

The compartment containing the sound unit becomes detached easily and generates small parts (the lid of the compartment). A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Import rejected at border

Description: Baby dolls with sound unit and accessories: 1.) baby with a cap and various accessories, tray with spaces for food, cutlery and a baby's bottle. 2.) baby with long hair and various accessories, rattle and baby's bottle. Packaging: cardboard box with transparent window.

Batch number/Barcode: 1.) 8422259326069; 2.) 8422259326076

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0052/17

Product: Convertible high chair for dolls

Name: Unknown

Risk: Entrapment

Category: Toys

Brand: Toys'R'Us / You & Me

Type/number of model: REF. 5F62572

Risk level: Serious risk

The space between the moving elements of the feet of the high chair is insufficient: a child could insert his fingers, leading to a risk of entrapment. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


Measures ordered by public authorities: Import rejected at border

Description: Set of accessories for a doll which turns into a high chair, a back pack, a hammock, a bag and a rocking chair. The product is supplied in a cardboard box with a window.

Batch number/Barcode: 803516525445; batch 05202016

Country of origin: China

Alert submitted by: Spain

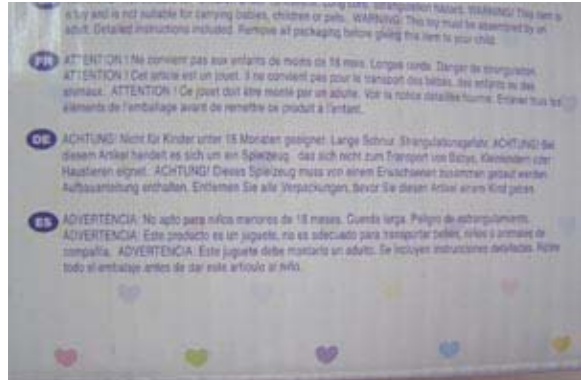

Alert number: A12/0056/17

Product: Toy scooter

Name: SPEED FIRE

Risk: Injuries

Category: Toys

Brand: SUN & SPORT

Type/number of model: RDF50233

Risk level: Serious risk

The steering tube can become detached if the child using the scooter pulls the handlebars upwards, which can cause the child to fall and get injured. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Toy scooter with three wheels, one in the front and two behind.

Batch number/Barcode: BLD 5064

Country of origin: China

Alert submitted by: France



Alert number: A12/0057/17

Product: Toy scooter

Name: SCOOTER

Risk: Chemical, Entrapment, Injuries

Category: Toys

Brand: Toi Toys

Type/number of model: reference n°62850

Risk level: Serious risk

The steering tube may easily break while a child is riding and the scooter is not sufficiently stable, which may cause the child to fall. The grips protecting the handlebar ends can detach. If a child falls on the unprotected handlebar end, this can cause injuries such as puncture of the abdomen. There are gaps between the wheels and the body of the scooter where fingers can become trapped. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1. The plastic of the grips contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 4.6% by weight) and dibutyl phthalate (DBP) (measured value 0.4 % by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: Green three-wheeled scooter (two wheels at the front). Cardboard packaging with a photograph of four scooters of the same model (pink, red, green and blue).

Batch number/Barcode: 8714627628500; Batch 814145

Country of origin: Unknown

Alert submitted by: France



Alert number: A12/0059/17

Product: Whistle

Name: Train Whistle

Risk: Choking

Category: Toys

Brand: Toi-Toys

Type/number of model: 53075

Risk level: Serious risk

Small parts detach easily from the product and can be put in the mouth by small children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Plastic whistle with a plastic locomotive on top. Packaged in a cardboard-blister packaging.

Batch number/Barcode: 8714627530759; batch 110380

Country of origin: China

Alert submitted by: Belgium



Alert number: A12/0061/17

Product: Activity play mat

Name: Unknown

Risk: Choking, Damage to hearing

Category: Toys

Brand: Baby Mix

Type/number of model: TT-01917453

Risk level: Serious risk

The plastic elements connecting the rattles to the arch can break, producing small parts which could cause choking. The sound pressure level of the rattles is too high which could cause damage to hearing. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Withdrawal of the product from the market (By: Manufacturer)

Description: Round activity play mat with rattles suspended from two arches. Packed in a cardboard box.

Batch number/Barcode: Batch no.: 15TT-03; CN: 9503009990; EAN: 590437886822

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0062/17

Product: Juice bottle with surprise toy

Name: Unknown

Risk: Choking

Category: Toys

Brand: Disney/ Star Wars

Type/number of model: 1) The Good Dinosaur; 2) Frozen; 3) Disney Princess; 4) Star Wars; 5) Minnie Mouse

Risk level: Serious risk

The product poses a risk of choking due to small parts (toy egg-shaped package). A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Import rejected at border

Description: Plastic bottles (300 ml) containing a fruit juice and a surprise toy. The bottles are labelled with shrink-wrap film and they have a sports-type cap. Underneath the shrink-wrap film there is an indentation for a surprise toy. The toy is packed inside an orange plastic egg.

Batch number/Barcode: 1) 8594023923658; 2) 8594023923672; 3) 8594023923672; 4) 8594023923658; 5) 8594023923689

Country of origin: Czech Republic

Alert submitted by: Finland



Alert number: A11/0002/17

Product: Footbath for animals

Name: Healthy Hooves 103 Ultimate

Risk: Environment

Category: Chemical products

Brand: Healthy Hooves

Type/number of model: Unknown

Risk level: Other risk level

The product poses a threat to the environment since it contains active substances (copper sulphate and zinc sulphate) that may not be used in this kind of biocide (product type 3). The product does not comply with the Regulation on biocidal products.


Measures ordered by public authorities: Withdrawal of the product from the market

Description: 25l container with a label showing cows

Batch number/Barcode: Unknown

Country of origin: Unknown

Alert submitted by: Germany

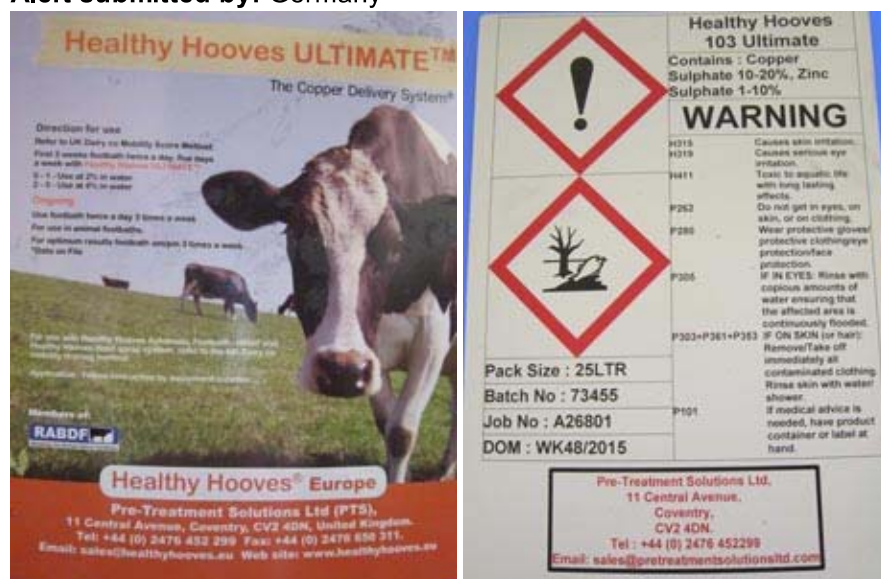

Alert number: A11/0003/17

Product: Shower tray

Name: Unknown

Risk: Cuts

Category: Construction products

Brand: KIOTO and OSAKA

Type/number of model: KIOTO and OSAKA range

Risk level: Other risk level

The metal shower waste cover has sharp edges on its underside and may easily be positioned upside down since the differences between the top and underside are not sufficiently visible. If the user positions the cover upside down, the sharp edges present a risk of cuts. The product does not comply with the relevant European standard EN 14527.

Measures taken by economic operators: Making the marketing of the product subject to prior conditions (By: Distributor)

Description: Shower tray with metal waste cover.

Batch number/Barcode: Unknown

Country of origin: Spain

Alert submitted by: France



Alert number: A11/0005/17

Product: Mountain bicycle

Name: MTB Nice

Risk: Injuries

Category: Hobby/sports equipment

Brand: LEADER CHICAGO 009

Type/number of model: Unknown

Risk level: Other risk level

The front fork is not strong enough and could break. The product does not comply with the requirements of the relevant European standard EN 4210.

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures

Description: Mountain bicycle for men, packed in a cardboard box.

Batch number/Barcode: 2000123316093

Country of origin: Bulgaria

Alert submitted by: Lithuania



Alert number: A11/0006/17

Product: LED floodlight

Name: Unknown

Risk: Electric shock

Category: Lighting equipment

Brand: LIGHTEX

Type/number of model: FELED 50CW

Risk level: Other risk level

The electrical insulation is inadequate. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: LED floodlight in cardboard box.

Batch number/Barcode: 3800883644455

Country of origin: China

Alert submitted by: Bulgaria



Alert number: A11/0007/17

Product: LED floodlight

Name: LED Floodlight

Risk: Electric shock, Fire

Category: Lighting equipment

Brand: V-TAC

Type/number of model: VT-4710 PIR; SKU:5355

Risk level: Other risk level

The conductors in the cable are too thin and could overheat in the event of a short circuit. The electrical insulation is inadequate which could lead to accessible parts becoming live. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures taken by economic operators: Withdrawal of the product from the market (By: Manufacturer)

Description: LED floodlight in cardboard box.

Batch number/Barcode: 3800230623324

Country of origin: China

Alert submitted by: Bulgaria



Alert number: A11/0008/17

Product: LED floodlight

Name: PRIME LED 30W

Risk: Electric shock

Category: Lighting equipment

Brand: VIVALUX

Type/number of model: 003570/0615

Risk level: Other risk level

The electrical insulation is inadequate which could lead to accessible parts becoming live. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures taken by economic operators: Withdrawal of the product from the market (By: Manufacturer)

Description: LED floodlight in cardboard box.

Batch number/Barcode: 3800228022757

Country of origin: China

Alert submitted by: Bulgaria



Alert number: A11/0004/17

Product: Angle grinder

Name: DAG-600-B

Risk: Fire

Category: Machinery

Brand: Defort

Type/number of model: DAG-600-B

Risk level: Other risk level

The grinder can overheat during use which could lead to a fire. The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 60745.

Measures taken by economic operators: Destruction of the product, Withdrawal of the product from the market (By: Retailer)

Description: Angle grinder with cardboard packaging.

Batch number/Barcode: 4260123724245

Country of origin: China

Alert submitted by: Croatia

