



CONSUMERS

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

week 13 - 2017

Alert number: A12/0362/17

Product: Girls' dress

Name: Unknown

Risk type: Injuries

Category: Clothing, textiles and fashion items

Brand: Serafino

Type / number of model: SE 15-4091

Risk level: Serious risk

The cords on the sleeves and in the waist area can become trapped during various activities of a child, leading to injuries. The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Multicolored dress intended for small girls. The garment bears functional cords in the sleeve and waist area.

Batch number / Barcode: Unknown

Country of origin: Greece

Alert submitted by: Cyprus



Alert number: A12/0370/17

Product: Fancy-dress accessory

Name: BEARD WITH MOUSTACHE

Risk type: Burns

Category: Clothing, textiles and fashion items

Brand: WIDMANN

Type / number of model: COM 1353 NG

Risk level: Serious risk

The beard is highly flammable and can cause burns, mostly to the face, if it catches fire.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Fancy-dress beard with moustache. Transparent plastic packaging with cardboard inside.

Batch number / Barcode: Unknown

Country of origin: Unknown

Alert submitted by: Spain



Alert number: A12/0367/17

Product: Eye Cream

Name: Eye Performer Gel Supérieure

Risk type: Chemical

Category: Cosmetics

Brand: DeAura D`or mystère

Type / number of model: Unknown

Risk level: Serious risk

The cream contains methylisothiazolinone (MI) and methylchloroisothiazolinone (MCI). Dermal contact with MCI/MI-containing products can provoke allergic contact dermatitis to sensitised persons. According to the Cosmetic Products Regulation, MCI/MI is prohibited in leave-on cosmetic products.

Measures taken by economic operators: Ban on the marketing of the product and any accompanying measures, Warning consumers of the risks, Withdrawal of the product from the market (By: Retailer)

Description: Cream in a dark brown plastic tube 30 ml.

Batch number / Barcode: 7290106492387, Batch number: 07091816

Country of origin: Israel

Alert submitted by: Estonia



Alert number: A12/0356/17

Product: Electric convector heater

Name: Electric convector heater

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: ELDOM

Type / number of model: CW1000M, CW1500M, CW2000M, CW2500M, CW3000M

Risk level: Serious risk

The product does not provide adequate protection against accidental contact with live parts, which can lead to electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.


Measures ordered by public authorities: Withdrawal of the product from the market

Description: The product comes in a white cardboard package with a photo of the appliance on the outside. The product itself consists of a white metallic casing containing all the electrical parts and a white power cord.

Batch number / Barcode: 3800035710533

Country of origin: Bulgaria

Alert submitted by: Cyprus

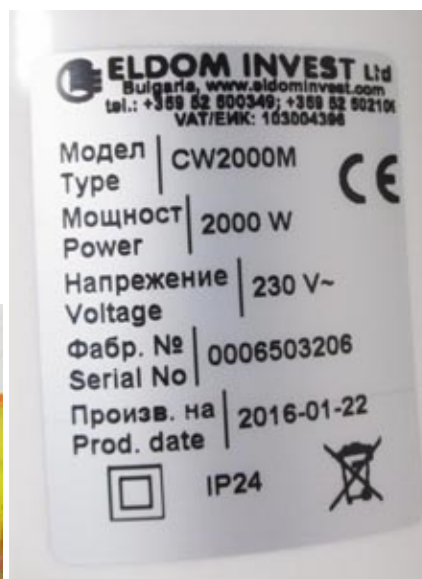

Alert number: A12/0358/17

Product: LED ceiling light

Name: LED Panel Light

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: JSG Accessories

Type / number of model: Driver: XS018-18W, Luminaire : LP-R-15W

Risk level: Serious risk

Once the product has been installed and connected to the main electric supply, the internal voltage may jump the barriers, causing the secondary circuit to overheat and lead to a fire. The outer parts of the product may become live which could lead to a potential electric shock. The product does not comply with the requirements of the Low Voltage Directive.

Measures taken by economic operators: Destruction of the product (By: Manufacturer)

Description: Round, white, LED, ceiling light panel - Input voltage AC85-265V, with attached LED driver - Input AC176-265V. Packaged in a printed cardboard box (20 pieces packed in a brown cardboard box).

Batch number / Barcode: 5 060215 272079

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/0382/17

Product: USB Charger

Name: Portable Charging Kit

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: ELETRA

Type / number of model: Unknown

Risk level: Serious risk

The insulation and the creepage and clearance distances are insufficient. The user could touch live parts of the plug and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Charging set with USB port, sold in a blister package.

Batch number / Barcode: 4894526014988

Country of origin: China

Alert submitted by: Finland



Alert number: A12/0359/17

Product: Airsoft gun

Name: Air Sport Gun

Risk type: Damage to sight

Category: Hobby/sports equipment

Brand: GAN YUAN

Type / number of model: 777

Risk level: Serious risk

The product is not correctly labelled with regard to the laser. The misleading use of CE marking will lead the user to the conclusion that the product is safe and consequently use it in a manner that could cause damage to sight, as direct viewing of the laser could cause damage to the eyes. The product does not comply with the relevant European standard EN 60825-1 with respect to labelling.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Black, spring-piston plastic air gun with laser aimer and flash light, packed in styrofoam and cardboard box. Packaging incorrectly marked with the CE mark.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/0364/17

Product: Airsoft gun

Name: Gun series

Risk type: Damage to sight

Category: Hobby/sports equipment

Brand: SKYMA

Type / number of model: SM.0905A

Risk level: Serious risk

The product is not correctly labelled with regard to the laser. The misleading use of CE marking will lead the user to the conclusion that the product is safe and consequently use it in a manner that could cause damage to sight, as direct viewing of the laser could cause damage to the eyes. The product does not comply with the relevant European standard EN 60825-1 with respect to labelling.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Black, spring-piston, plastic air gun with laser aimer and flash light, packed in styrofoam and in a cardboard box. Packaging incorrectly marked with the CE mark.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/0365/17

Product: Airsoft gun

Name: Cross Fire

Risk type: Damage to sight

Category: Hobby/sports equipment

Brand: HUANGHE - H H

Type / number of model: NO.FY609B

Risk level: Serious risk

The product is not correctly labelled with regard to the laser. The misleading use of CE marking will lead the user to the conclusion that the product is safe and consequently use it in a manner that could cause damage to sight, as direct viewing of the laser could cause damage to the eyes. The product does not comply with the relevant European standard EN 60825-1 with respect to labelling.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Black, spring-piston, plastic air pistol, with laser aimer and flash light, packed in Styrofoam and into two different cardboard box. Packaging incorrectly marked with the CE mark and there is an age warning sign (AGE: ABOVE 18 YEARS).

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/0388/17

Product: Jewellery set

Name: Armband + Kette (Bracelet and necklace)

Risk type: Chemical

Category: Jewellery

Brand: TEDi

Type / number of model: 116

Risk level: Serious risk

The amount of nickel released by the bracelet is too high (measured value: 3.22 µg/cm²/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product does not comply with the REACH Regulation.

Measures taken by economic operators: Recall of the product from end users (By: Importer)
Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: Jewellery set consisting of a bracelet and necklace made of metal and plastic.

Batch number / Barcode: 75354001751000000500

Country of origin: China

Alert submitted by: Germany



Alert number: A12/0405/17

Product: Earrings

Name: Earring with stone

Risk type: Chemical

Category: Jewellery

Brand: Nisu International

Type / number of model: Unknown

Risk level: Serious risk

The amount of cadmium in the earrings is too high (measured value up to 25.1 % by weight). Cadmium is harmful to human health because it accumulates in the body and can damage organs and may cause cancer. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: Silver-coloured earrings with 3 blue stones .

Batch number / Barcode: 8715889677558

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0401/17

Product: Laser pointer

Name: Unknown

Risk type: Damage to sight

Category: Laser pointers

Brand: Unknown

Type / number of model: Unknown

Risk level: Serious risk

The laser beam is too powerful and the product is not correctly labelled. Direct viewing of the laser beam could cause damage to sight. The product does not comply with the relevant European standard EN 60825-1 with respect to labelling.


Measures ordered by public authorities: Other

Description: Laser pointer

Batch number / Barcode: Unknown

Country of origin: The Netherlands

Alert submitted by: Germany

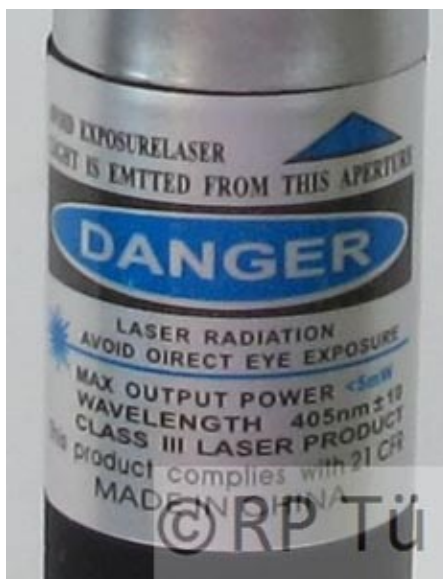

Alert number: A12/0361/17

Product: String lights

Name: Unknown

Risk type: Electric shock

Category: Lighting chains

Brand: Unknown

Type / number of model: EK-04

Risk level: Serious risk

The live parts of the travel adaptor can be easily touched by users as there are no safety gates preventing access. A person could touch the live part of the adaptor and receive an electric shock. The product does not comply with the Low Voltage Directive, the Electrical Equipment (Safety) Regulations 1994 or BS 1363.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: Warm white LED light string garland with UK travel adaptor. Packed in a blue box with snowy pine trees, with white stars and patterns around the edge; orange, yellow and white text written in Russian; image of Santa Claus with a circle of small yellow stars around.

Batch number / Barcode: X000LFDNWT

Country of origin: Hong Kong

Alert submitted by: United Kingdom



Alert number: A12/0397/17

Product: Floodlight

Name: LED-arbejdslampe

Risk type: Electric shock

Category: Lighting equipment

Brand: nor-tec

Type / number of model: 74630 (LXA-ZD2924-50W)

Risk level: Serious risk

The sheath of the cable is not sufficiently resistant to cold and can crack under bending stress. If the cable is damaged the user could touch live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598.


Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: LED flood light for building sites. Sold in a white cardboard box.

Batch number / Barcode: 5709386746308

Country of origin: China

Alert submitted by: Finland

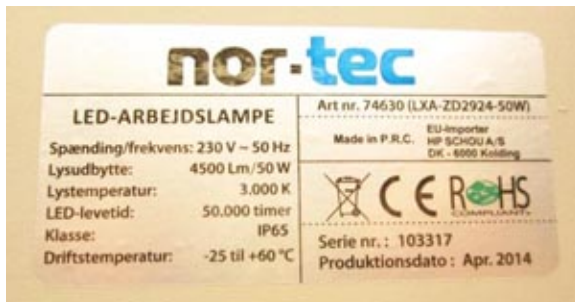

Alert number: A12/0360/17

Product: Angle grinder

Name: Unknown

Risk type: Cuts, Injuries

Category: Machinery

Brand: Keyang

Type / number of model: DG-1400A

Risk level: Serious risk

The protection guard of the tool can rotate 160° and provides insufficient protection against loose flying fragments generated during use. The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 60745.

Measures ordered by public authorities: Temporary ban on the supply, offer to supply and display of the product (By: Distributor)

Description: Angle grinder packed in cardboard box. Specification: 220-240 V AC, 50/60 Hz, 1400 W.

Batch number / Barcode: 001485

Country of origin: Republic of Korea

Alert submitted by: Poland



Alert number: A12/0402/17

Product: Angle grinder

Name: Unknown

Risk type: Injuries

Category: Machinery

Brand: BOSCH

Type / number of model: models GWS 20, 22, 24 y PWS 20, 1900, 2000 (without braking function) and GWS 24-230 JVX (with braking function)

Risk level: Serious risk

The cutting or grinding wheel, together with the clamping device, could come loose when the angle grinder is in operation, leading to injury of the user. The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 60745.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Angle grinder.

Batch number / Barcode: Manufactured between June 2016 and August 2016 (models GWS 20, 22, 24 y PWS 20, 1900, 2000) and from February 2016 to October 2016 (models GWS 24-230 JVX)

Country of origin: Russian Federation

Alert submitted by: Spain

Products were found and measures were taken also in: France, Slovenia



Alert number: A12/0403/17

Product: Mini Motorbike

Name: KTM 50 SX and Husqvarna TC 50

Risk type: Injuries

Category: Machinery

Brand: Husqvarna, KTM

Type / number of model: Husqvarna TC 50 model year 2017 , KTM 50 SX model year 2017

Risk level: Serious risk

The drive chain connecting link might fail and as a consequence the chain can break, leading to injury of the user. Furthermore, there is a risk the user may fall which, at the speeds expected of these vehicles, could lead to severe injuries. The product does not comply with the requirements of the Machinery Directive.

Measures taken by economic operators: Other (By: Manufacturer)

Description: Mini motorbike (minibike) for children and young people, not intended for road transport.

Batch number / Barcode: Unknown

Country of origin: Austria

Alert submitted by: Austria



Alert number: A12/0363/17

Product: Passenger car

Name: C3 Picasso

Risk type: Injuries

Category: Motor vehicles

Brand: Citroën

Type / number of model: e2*2001/116*0371*28, e2*2001/116*0371*29, e2*2007/46*0110*11

Risk level: Serious risk

The right-hand front-seat airbag may contain a faulty activator device. In the event of a side impact, the airbag would not deploy.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number / Barcode: Manufactured between 8/09/2016 and 14/10/2016

Country of origin: France

Alert submitted by: France

Products were found and measures were taken also in: The Netherlands

Alert number: A12/0369/17
Product: Passenger car
Name: Wrangler
Risk type: Injuries
Category: Motor vehicles
Brand: Jeep
Type / number of model: Type approval number: e4*2001/116*0116*02 Type: JK
Risk level: Serious risk
Dirt on the terminal spool of the steering column can lead to the driver airbag failing to be released.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Passenger car.
Batch number / Barcode: The vehicles in question were manufactured between 2 March 2006 and 13 August 2010.
Country of origin: United States
Alert submitted by: Germany
Products were found and measures were taken also in: Ireland, Poland, The Netherlands

Alert number: A12/0373/17
Product: Van
Name: Talento
Risk type: Injuries
Category: Motor vehicles
Brand: Fiat
Type / number of model: Type approval number: e2*2007/46*0497*01 Type: FFL
Risk level: Serious risk
Details about the maximum tensile forces of the load-retaining hook in cargo spaces are incorrect. This could lead to the cargo being unsecured.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Van
Batch number / Barcode: The vehicles in question were manufactured between March 2016 and October 2016.
Country of origin: France
Alert submitted by: Germany
Products were found and measures were taken also in: Ireland

Alert number: A12/0377/17
Product: Passenger car
Name: Giulietta, Mito
Risk type: Injuries
Category: Motor vehicles
Brand: Alfa Romeo
Type / number of model: Type-approval numbers: e3*2007/46*0027*00, e3*2001/116*0278*09; types: 940, 955
Risk level: Serious risk
Due to a fault in the airbag propellant system, the second stage airbag might not deploy correctly or not deploy at all in the event of an accident.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Passenger car.
Batch number / Barcode: Vehicles produced between September 2010 and December 2015 are affected.
Country of origin: Italy
Alert submitted by: Germany
Products were found and measures were taken also in: The Netherlands

Alert number: A12/0386/17

Product: Motorcycle

Name: Chief, Chieftain, Roadmaster, Springfield, Vintage, Chief Darkhorse, Chieftain Darkhorse

Risk type: Fire

Category: Motor vehicles

Brand: Polaris

Type / number of model: Type-approvals: e4*2002/24*3012*00-*04, e4*2002/24*3013*00-*03, e4*168/2013*00013*00, e4*168/2013*00014*00; types: C, T

Risk level: Serious risk

The fuel line may come into contact with other parts. This may cause a fuel leakage and could generate a fire.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Motorcycle

Batch number / Barcode: The vehicles concerned were produced between 2014 and 2017

Country of origin: United States

Alert submitted by: Germany

Alert number: A12/0387/17

Product: Passenger cars/ Van/ Pick-up

Name: Up, e-Up, Polo, Scirocco, Passat, Golf, Sportsvan, Touran, Tiguan, Amarok, T5, Transporter

Risk type: Injuries

Category: Motor vehicles

Brand: VW

Type / number of model: Type-approval numbers: e1*2007/46*0356, e1*2007/46*0623, e1*2007/46*0627, e1*2001/116*0307, e1*2001/116*0510, e1*2001/116*0471, e1*2001/116*0450, e1*2001/116*0211, e1*2007/46*0130, e1*2001/116*0220, e1*2001/116*0286, e1*2001/116*0218, e1*2001/116*0289, e13*2007/46*1167 and 1182; types: 2H, AU, AUV, 3C, 6R, 13, 5N, AD, 1T, 7J0, 7HC, 7HCA, 7HM, 7HMA, AA, AAN

Risk level: Serious risk

Some vehicles have differences in the mixture ratio for the initiating device, which could lead to the driver and passenger airbag or seat-belt pre-tensioner not activating in the event of an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number / Barcode: The vehicles concerned were produced between 8 July 2016 and 6 February 2017.

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: The Netherlands

Alert number: A12/0389/17

Product: Motorcycle

Name: YZF-R3, MT-03/A

Risk type: Injuries

Category: Motor vehicles

Brand: Yamaha

Type / number of model: Type approval number: e13*2002/24*0741 Type: RH07

Risk level: Serious risk

Engine vibrations can cause the tank to start leaking fuel. Furthermore, water seeping into the ignition lock can cause corrosion on the circuit board, which would lead to total electrical failure.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Motorcycle.

Batch number / Barcode: The vehicles in question were manufactured between 2015 and 2016.

Country of origin: Indonesia

Alert submitted by: Germany

Products were found and measures were taken also in: Poland, The Netherlands

Alert number: A12/0390/17
Product: All-terrain vehicle
Name: RZR & General
Risk type: Burns, Fire, Injuries
Category: Motor vehicles
Brand: Polaris
Type / number of model: General and General 4, RZR 900, RZR 900XC, RZR S900 RZR 4 900, RZR S1000, RZR XP/XP4 1000, RZR XP/XP4 1000 high lifter, RZR XP Turbo
Risk level: Serious risk
The brake master cylinder may have been contaminated during manufacturing which may cause the front brake circuit seal to swell, which could cause a vehicle fire.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: All-terrain vehicle/side-by-side.
Batch number / Barcode: Vehicles produced from 02/02/2016 - 23/06/2016
Country of origin: United States
Alert submitted by: United Kingdom

Alert number: A12/0392/17
Product: Passenger car/ Van
Name: Peugeot Bipper Trak and Citroën Memo trek
Risk type: Injuries
Category: Motor vehicles
Brand: DANGEL
Type / number of model: V65P (Peugeot) e2*KS07/46*008*01, e2*2007/46*0271*02 V65c (Citroën) e2*KS07/46*0009*01, e2*2007/46*0270*02
Risk level: Serious risk
The riser shims on the rear suspension are inadequate. As a consequence, cracks in the anchorage of the rear axle to the body might appear when the vehicle is subject to heavy-duty use.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Van/Passenger car
Batch number / Barcode: Vehicles produced between 1 January 2012 and 30 March 2016
Country of origin: France
Alert submitted by: France

Alert number: A12/0393/17
Product: All-terrain vehicle
Name: RZR & General
Risk type: Burns, Fire, Injuries
Category: Motor vehicles
Brand: Polaris
Type / number of model: General , RXR 1000
Risk level: Serious risk
The vehicle engine can misfire allowing unburned fuel to be routed into the exhaust system, which can cause excessive exhaust heat that may lead to a fire.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: All-terrain vehicle/Side-by-side vehicles.
Batch number / Barcode: RXR 1000 and General produced 01/12/2005 - 15/06/16
Country of origin: United States
Alert submitted by: United Kingdom

Alert number: A12/0396/17

Product: Passenger car

Name: C4, DS4

Risk type: Injuries

Category: Motor vehicles

Brand: Citroen

Type / number of model: EC type-approvals: e2*2007/46*0040, e2*2007/46*0079, e24*2007/46*0027*00; types: N, N*5FL; sales description: C4, DS4

Risk level: Serious risk

The cable of the catch inside the bonnet may be insufficiently secured. As a result, the bonnet might open unexpectedly while the vehicle is in motion, which could cause an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number / Barcode: The vehicles concerned were produced between 2009 and 2016

Country of origin: France

Alert submitted by: Germany

Products were found and measures were taken also in: The Netherlands

Alert number: A12/0400/17

Product: Lorry

Name: T, D, D-Wide

Risk type: Injuries

Category: Motor vehicles

Brand: RENAULT

Type / number of model: e2*2007/46*0031, e2*2007/46*0033, e2*2007/46*0322, e2*2007/46*0323, e2*2007/46*0229, e2*2007/46*0230, e2*2007/46*0162

Risk level: Serious risk

In certain circumstances, possible loosening of the rear suspension screw joints may occur during driving causing the rear axle to become misaligned, resulting in loss of stability and trajectory of the vehicle.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Lorry

Batch number / Barcode: Vehicles produced between 3 November 2014 and 17 November 2016

Country of origin: France

Alert submitted by: France

Alert number: A12/0404/17

Product: ATV SxS, ATV Side by Side

Name: EGI Motors

Risk type: Burns, Fire

Category: Motor vehicles

Brand: Ranger XP, Crew XP 900

Type / number of model: Unknown

Risk level: Serious risk

The cargo box bracket fasteners may become loose or dislodged under certain operating conditions. If this occurs, the exhaust may overheat and the seat panel may catch fire.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: All-terrain vehicle.

Batch number / Barcode: The vehicles in question were manufactured between 25 April 2013 and 13 May 2014.

Country of origin: United States

Alert submitted by: Germany

Alert number: A12/0366/17

Product: Safety shoes

Name: Unknown

Risk type: Injuries

Category: Protective equipment

Brand: Security Line

Type / number of model: New Sena S3

Risk level: Serious risk

The shoes are not sufficiently resistant to impact. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN ISO 20345.

Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Safety shoes supplied in a cardboard box. Sample size: 38.

Batch number / Barcode: 1600013900367 and 8423268272385

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0368/17

Product: Safety shoes

Name: Unknown

Risk type: Injuries

Category: Protective equipment

Brand: SECURITY LINE

Type / number of model: NEW LANDA EL BRN

Risk level: Serious risk

The shoes are not sufficiently resistant to impact and/or compression. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN ISO 20345.

Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Safety boots supplied in a cardboard box. Sample size: 38.

Batch number / Barcode: 1600013153862 and 8435006068389

Country of origin: India

Alert submitted by: Spain



Alert number: A12/0383/17

Product: Visibility clothing

Name: TIREX

Risk type: Injuries

Category: Protective equipment

Brand: Makito

Type / number of model: 4648

Risk level: Serious risk

The retroreflective/luminance performance of the product is inadequate. As a result, the user is not sufficiently visible in situations where high visibility is essential. This product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN 1150.

Measures taken by economic operators: Recall of the product from end users (By: Retailer)

Description: Pink visibility vest, packed in a transparent plastic bag.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Sweden



Alert number: A12/0384/17

Product: Safety shoes

Name: Calzado de Seguridad (Safety shoes)

Risk type: Injuries

Category: Protective equipment

Brand: TAO / Security Line

Type / number of model: New Tibet S3

Risk level: Serious risk

The safety shoes are not sufficiently resistant to impact and/or compression. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN ISO 20345.

Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Safety boots.

Batch number / Barcode: 1600013143016 and 8423268281400

Country of origin: India

Alert submitted by: Spain



Alert number: A12/0385/17

Product: Safety shoes

Name: Unknown

Risk type: Injuries

Category: Protective equipment

Brand: Security Line

Type / number of model: New Sanson S3

Risk level: Serious risk

The safety shoes are not sufficiently resistant to impact and/or compression. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN ISO 20345.


Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Safety boots.

Batch number / Barcode: 1600013954148 and 8423268286474

Country of origin: China

Alert submitted by: Spain

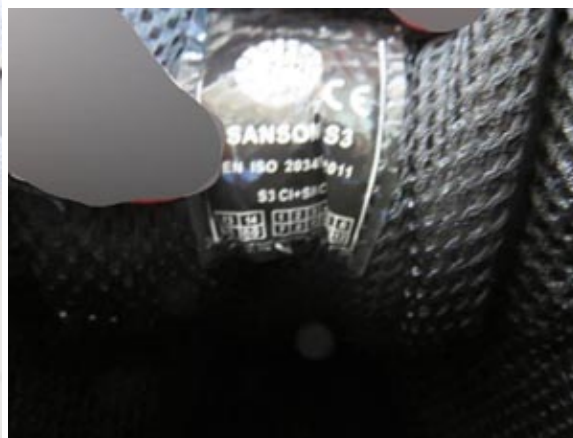

Alert number: A12/0391/17

Product: Fireworks

Name: Dum Bum

Risk type: Damage to hearing

Category: Pyrotechnic articles

Brand: Klásek

Type / number of model: P6A

Risk level: Serious risk

The sound pressure level is too high and this can cause damage to hearing. The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Manufacturer)

Description: Fireworks (Flash Bangers) individually embedded into a box holding 20 pieces.

Batch number / Barcode: mark CE 1395, reg. no. 1395-00525/2012, year of manufacture 2016

Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0380/17

Product: Jet ski

Name: Unknown

Risk type: Fire

Category: Recreational crafts

Brand: YAMAHA

Type / number of model: 1.) VX1050, code F4F , 2.) FA1800, code F2S, 3.) FB1800, code F2T, 4.) FC1800, code F3J, 5.) GX1800A, code F3K, 6.) GX1800, code F3L, 7.) VC1800, code F4E, 8.) VX1800, code F2W

Risk level: Serious risk

The fuel line clamp may have been incorrectly fitted which may cause the fuel line to come loose, causing the fuel to spill inside the hull.

Measures taken by economic operators: Recall of the product from end users (By: Distributor)

Description: Jet ski.

Batch number / Barcode: 1.) serial No 800101 to 804800, manufactured December 2015 to May 2016, 2.) serial No 813101 to 813700, manufactured September 2015 to April 2016, 3.) serial No 815901 to 819700, manufactured June 2015 to May 2016, 4.) serial No 810201 to 815600, manufactured June 2015 to May 2016, 5.) serial No 804301 to 806000, manufactured September 2015 to February 2016, 6.) serial No 803001 to 804500, manufactured September 2015 to April 2016, 7.) serial No 800101 to 802700, manufactured November 2015 to May 2016, 8.) serial No 803701 to 806500, manufactured September 2015 to February 2016

Country of origin: United States

Alert submitted by: Spain

Alert number: A12/0357/17

Product: Children's fancy-dress costume

Name: Party costume

Risk type: Injuries, Strangulation

Category: Toys

Brand: ARTPRO

Type / number of model: 08-219-N6

Risk level: Serious risk

The cords in the neck area and attached to the trousers can become trapped during various activities of a child, leading to strangulation or injuries. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 14682.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Black/red Ninja fancy-dress costume for children. The garment consists of a shirt bearing functional cords, trousers with functional cords (length 24 cm) and a black-coloured hood (head cover). Sample size 6.

Batch number / Barcode: 6936065483714

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/0371/17

Product: Kitchen play set

Name: Kitchen

Risk type: Choking

Category: Toys

Brand: ATOSA

Type / number of model: model 6069-1, ref. MA4536, cod. 14671

Risk level: Serious risk

A part of the toy chopping board may come loose, generating a small part. A small child may put it in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: Plastic toy consisting of small kitchen utensils and various coloured foods. The product comes in a cardboard and plastic blister packaging.

Batch number / Barcode: 8422259146711

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0372/17

Product: Plastic doll

Name: Lalka syrenka [Mermaid doll]

Risk type: Chemical

Category: Toys

Brand: Mega Creative

Type / number of model: Index 304123

Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 34.3% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: The set consists of a plastic mermaid doll (approx 30 cm) and small plastic sea creatures. The doll's torso and hands are made of hard plastic material; the head and tail are made of soft plastic material. Plastic packaging with a cardboard back.

Batch number / Barcode: 5901350244296

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0374/17

Product: Plush dog with light and sound

Name: Modish dancing dog

Risk type: Choking

Category: Toys

Brand: OU XIANG

Type / number of model: ref. 270

Risk level: Serious risk

The dog's nose and eyes come off easily, generating small parts. A small child may inhale or ingest them, causing choking. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Battery-operated plush dog that emits lights and sounds. Packaging: cardboard box with transparent window.

Batch number / Barcode: 8498565552805

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0375/17

Product: Toy police set

Name: Police Gun

Risk type: Choking

Category: Toys

Brand: Unknown

Type / number of model: Ref. no. 2120073738, Ref. no. A052-71 (on attached label) NO:052 (on toy pistol)

Risk level: Serious risk

The suction cups of the projectiles detach easily. If a child puts the projectile in the mouth, the suction cup may come loose and obstruct the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: The set consists of: a toy pistol with holster, three projectiles with suction cups, a police signaling device. Plastic packaging with cardboard back.

Batch number / Barcode: 5900851737382

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0376/17

Product: Baby doll

Name: My Baby & Me Doll

Risk type: Choking

Category: Toys

Brand: A.I.&E.

Type / number of model: Item no. 98172

Risk level: Serious risk

Small plastic parts can be easily detached from the doll's accessories (top of plastic bottle, part of soother, etc.). A small child could put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Recall of the product from end users (By: Importer)

Description: Baby doll with various accessories (12 pcs) in a cardboard box with transparent window.

Batch number / Barcode: 8711252981727; Batch: 2017065

Country of origin: China

Alert submitted by: The Netherlands

Products were found and measures were taken also in: Luxembourg



Alert number: A12/0378/17

Product: Plastic doll

Name: Barbie Beauty Girl

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: Model 268-D, ref. 35178, MA8781

Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 16.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Plastic doll set consisting of two dolls with sports accessories such as a bicycle, racket, glasses, etc.

Batch number / Barcode: 8422259351788

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0379/17

Product: Plastic doll set

Name: Barbie Beauty Girl

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: Model 268-B, ref. 35179, MA8782

Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 12% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Import rejected at border (By: Importer)

Description: Plastic doll set consisting of a doll with sports accessories such as a bicycle, skateboard, helmet, etc.

Batch number / Barcode: 8422259351795

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0381/17

Product: Magnetic toy

Name: Magnetisk labyrint / magnetic maze

Risk type: Injuries

Category: Toys

Brand: Unknown

Type / number of model: model 1701857

Risk level: Serious risk

The red stick, containing a magnet with a high magnetic flux, detaches easily from the toy. If a child swallows this part and other metal objects, they could attract each other causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Distributor)

Description: Panda-shaped, magnetic toy with a maze (puzzle) containing small coloured balls on the front and a red stick which contains a magnet for moving the balls through the maze. The toy comes in a white cardboard box with a transparent plastic lid.

Batch number / Barcode: 0200017018573, Lot 84690

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0394/17

Product: Fishing game

Name: Jeu de pêche à la ligne (Fishing game)

Risk type: Choking

Category: Toys

Brand: Unknown

Type / number of model: Product ref.: 1214

Risk level: Serious risk

The toy includes a small part (wooden key) that can be put in the mouth by small children causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Rectangular, cardboard container and four wooden fishing rods with string and a magnet at the end. It includes wooden parts in the shape of fish and a treasure chest with key.

Batch number / Barcode: Lot: 7894/2016; bar code: 26078946

Country of origin: Germany

Alert submitted by: France



Alert number: A12/0395/17

Product: Pull-along toy

Name: Unknown

Risk type: Strangulation

Category: Toys

Brand: Small Foot Company (LEGLER)

Type / number of model: art.6449

Risk level: Serious risk

The cord can easily be stretched and, as a consequence, becomes too long, which may cause strangulation if it wraps around the child's neck. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Pull-along family of 4 wooden ducks (1 big and 3 small), joined by a cord. Packaged in a cardboard box.

Batch number / Barcode: ean 4020972064493

Country of origin: Unknown

Alert submitted by: France

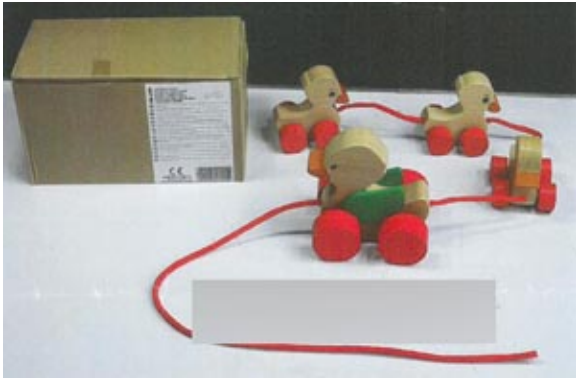

Alert number: A12/0398/17

Product: Wooden toy

Name: Ferme

Risk type: Choking

Category: Toys

Brand: Janod

Type / number of model: JO8571

Risk level: Serious risk

Small parts (e.g. the two rear wheels) can easily detach from the toy tractor. Small children may put these in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Distributor)

Description: Wooden toy set comprised of a tractor with trailer and a cow. Individually packed in a cardboard box with window.

Batch number / Barcode: 6652/JO8571/062015 EAN: 3700217385712

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0399/17

Product: Rattles

Name: Marakasy czerwone ('Red maracas')

Risk type: Choking

Category: Toys

Brand: Nowa Szkola

Type / number of model: PG1725

Risk level: Serious risk

The handles of the rattles are too long and too thin. If a small child puts the handle of a rattle in his/her mouth, the handle could obstruct the airways, posing a risk of choking. The shell of the maracas can tear and small parts can be released. The released small parts can be swallowed by small children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Retailer)

Description: Set of two red plastic maracas/rattles packed in transparent plastic.

Batch number / Barcode: Serial number 191442

Country of origin: Poland

Alert submitted by: The Netherlands



Alert number: A11/0057/17

Product: Life Vest

Name: Unknown

Risk type: Drowning

Category: Protective equipment

Brand: Aqua marina

Type / number of model: NGY 044

Risk level: Other risk level

The products lacks information for use and has no retroreflective material for good visibility at sea. The products does not comply with the requirements of the Personal Protective Equipment Directive 89/686/EEC and relevant European standard.

Measures ordered by public authorities: Import rejected at border, Other (By: Importer)

Description: Life vest packed in a plastic bag.

Batch number / Barcode: 6954521622200

Country of origin: China

Alert submitted by: Slovenia



Last update: 2017-03-16 Legal notice (http://ec.europa.eu/geninfo/legal_notices_en.htm) Contact (http://ec.europa.eu/contact/index_en.htm)