



European Commission (http://ec.europa.eu/index_en.htm) Consumers (http://ec.europa.eu/consumers/index_en.htm)

Consumers safety (http://ec.europa.eu/consumers/consumers_safety/index_en.htm)

Safety products (http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm)

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

week 16 - 2017

Notification A11/0046/17 in Report-2017-010 has been updated following new information from the notifying authority concerning the products affected. Notification A12/0212/17 in Report-2017-008 has been withdrawn following a revised risk assessment by the notifying authority.

Alert number: A12/0497/17

Product: Wooden cot

Name: Unknown

Risk type: Entrapment, Strangulation

Category: Childcare articles and children's equipment

Brand: ROBA

Type / number of model: Model LEO, Ref. 6291SKN740462

Risk level: Serious risk

The gaps between the bars are too large. A crawling child could try to pass his legs or torso between the bars, leaving the head blocked, which could cause respiratory difficulties or strangulation. In addition, the safety gate has holes where children's fingers could be trapped. The product does not comply with the relevant European standard EN 716.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Distributor)

Description: Children's cot with wooden rails. It is packed in a cardboard box.

Batch number / Barcode: 4005317233963

Country of origin: Germany

Alert submitted by: Spain



Alert number: A12/0518/17
 Product: Safety gate for children
 Name: Wood & Metal Safety Gate
 Risk type: Injuries, Strangulation
 Category: Childcare articles and children's equipment
 Brand: MS
 Type / number of model: Ref. 141021

Risk level: Serious risk

The gaps between the bars of the safety gate are too large: A crawling child could try to pass his legs or torso between the bars, leaving the head blocked, which could lead to respiratory difficulties or strangulation. The gate does not close automatically and a child might pass through the opening and fall down the stairs. In addition, the safety gate has protruding corners where the garments of a child could get caught, causing strangulation. The product does not comply with the relevant European standard EN 1930.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: Safety gate with measurements from 75 to 82 cm for children under the age of 24 months. The product is sold in a cardboard box.

Batch number / Barcode: 8436046381001

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0499/17

Product: Baby shoes

Name: Unknown

Risk type: Chemical

Category: Clothing, textiles and fashion items

Brand: Superfit

Type / number of model: Item No 0518

Risk level: Serious risk

The amount of chromium (VI) in the leather is too high (measured value up to 4,8 mg/kg), Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

Measures taken by economic operators: Withdrawal of the product from the market, Withdrawal of the product from the market (By: Manufacturer, Retailer)

Description: First-walker shoes for babies. The upper is made of dark and light grey leather, the edge of shoe and laces are of green fabric and the sole is made of dark grey plastic. Sample size: 21

Batch number / Barcode: 4-08324-07 and 461-20-0041 51 005

Country of origin: Austria

Alert submitted by: Germany



Alert number: A12/0500/17
 Product: Fancy-dress accessories
 Name: Body Parts
 Risk type: Burns
 Category: Clothing, textiles and fashion items
 Brand: PARTY FIESTA
 Type / number of model: Ref. 103690, JAP424B
 Risk level: Serious risk
 The beard is highly flammable and can cause burns if it catches fire.
 Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)
 Description: Fancy-dress accessories consisting of a pirate beard and moustache and an earring, packed in a plastic bag.
 Batch number / Barcode: 1036900010008
 Country of origin: China
 Alert submitted by: Spain



Alert number: A12/0515/17
 Product: Baby dress
 Name: Unknown
 Risk type: Choking
 Category: Clothing, textiles and fashion items
 Brand: MAYORAL
 Type / number of model: Ref. 52920 and 52962
 Risk level: Serious risk
 The buttons on the dresses come off easily. A small child may put them in the mouth and choke. The product does not comply with the relevant national standard.
 Measures ordered by public authorities: Import rejected at border (By: Importer)
 Description: One striped baby dress and one baby dress with flower motifs. A cardboard label is attached to the dresses.
 Batch number / Barcode: Unknown
 Country of origin: Morocco
 Alert submitted by: Spain



Alert number: A12/0517/17

Product: Baby clothing

Name: Unknown

Risk type: Choking

Category: Clothing, textiles and fashion items

Brand: La Ormiga

Type / number of model: 1710040702 , 1710101401

Risk level: Serious risk

The buttons detach easily. A child could put them in the mouth and choke on them. The product does not comply with the relevant national standard.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: 1) Baby romper suit for age 0-24 months. 2) Shirt for babies packaged in a transparent plastic bag.

Batch number / Barcode: Unknown

Country of origin: India

Alert submitted by: Spain



Alert number: A12/0509/17

Product: Carbon monoxide detector

Name: CO ALARM

Risk type: Asphyxiation

Category: Construction products

Brand: Pentagon

Type / number of model: JLP-01

Risk level: Serious risk

No indication is given in case of a defect of the sensor. It may fail to detect dangerous concentrations of carbon monoxide. The product does not comply with the requirements of the Construction Products Regulation and the relevant European standard EN 50291.

Measures ordered by public authorities: Recall of the product from end users (By: Importer)

Description: Carbon monoxide detector with white coloured, plastic housing, packed in transparent blister packing

Batch number / Barcode: 8717953003744; produced in 2015

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0510/17

Product: Carbon monoxide detector

Name: CARBON MONOXIDE DETECTOR

Risk type: Asphyxiation

Category: Construction products

Brand: Unknown

Type / number of model: PW-916

Risk level: Serious risk

No indication is given in case of a defect of the sensor. It may fail to detect dangerous concentrations of carbon monoxide. The product does not comply with the requirements of the Construction Products Regulation and the relevant European standard EN 50291.

Measures ordered by public authorities: Recall of the product from end users (By: Importer)

Description: Carbon monoxide detector in white coloured, plastic housing, packed in a cardboard box.

Batch number / Barcode: 8718781066840; PWUM 2011060301

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0511/17

Product: Carbon monoxide detector

Name: Carbon Monoxide Alarm

Risk type: Asphyxiation

Category: Construction products

Brand: Unknown

Type / number of model: PW-918

Risk level: Serious risk

The product is not marked with the recommended maximum lifetime. It may fail to detect dangerous concentrations of carbon monoxide. The product does not comply with the requirements of the Construction Products Regulation and the relevant European standard EN 50291.

Measures ordered by public authorities: Recall of the product from end users (By: Importer)

Description: Carbon monoxide detector in white coloured, plastic housing, packed in a cardboard box

Batch number / Barcode: 8718781066857

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0512/17

Product: Carbon monoxide detector

Name: Carbon Monoxide Detector

Risk type: Asphyxiation

Category: Construction products

Brand: Blaupunkt

Type / number of model: CO-S1

Risk level: Serious risk

No indication is given in case of a defect of the sensor. The product does not comply with the requirements of the Construction Products Regulation and the relevant European standard EN 50291.

Measures ordered by public authorities: Recall of the product from end users (By: Distributor)

Description: Carbon monoxide detector in white plastic housing, packed in a white cardboard box.

Batch number / Barcode: 4054512000191; M 0615

Country of origin: Taiwan

Alert submitted by: The Netherlands



Alert number: A12/0513/17

Product: Carbon monoxide detector

Name: Carbon Monoxide Alarm

Risk type: Asphyxiation

Category: Construction products

Brand: Pentagon

Type / number of model: EAP21H

Risk level: Serious risk

The product is not marked with the recommended maximum lifetime and does not have the warning to read the instructions carefully before operating or servicing. It may fail to detect dangerous concentrations of carbon monoxide. The product does not comply with the requirements of the Construction Products Regulation and the relevant European standard EN 50291.

Measures ordered by public authorities: Recall of the product from end users (By: Importer)

Description: Carbon monoxide detector

Batch number / Barcode: 8717953003706; Produced in July 2011.

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0493/17

Product: Hair colouring product

Name: Red Henna Kizil

Risk type: Chemical

Category: Cosmetics

Brand: GOLD

Type / number of model: Colour code 5

Risk level: Serious risk

According to the label, the product contains an ingredient, assumed to be 4-Amino-m-cresol. The substance is only permitted in oxidative hair colouring products with coupler substances and can cause allergic skin reactions and eye irritation. The product does not comply with the Cosmetic Products Regulation.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures (By: Distributor)

Description: Hair colour product (red powder): 6 plastic sachets of 10g each supplied in a cardboard box.

Batch number / Barcode: 8691833395221; KZ002 (packaging) KZ001 (container), expiry date 04/2017

Country of origin: Turkey

Alert submitted by: Germany



Alert number: A12/0508/17

Product: Carbon monoxide detector

Name: CO STOP

Risk type: Asphyxiation

Category: Electrical appliances and equipment

Brand: Elbes

Type / number of model: Unknown

Risk level: Serious risk

The product is not marked with the recommended maximum lifetime and does not have the warning to read the instructions carefully before operating or servicing. It may fail to detect dangerous concentrations of carbon monoxide. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 50291.

Measures ordered by public authorities: Recall of the product from end users (By: Distributor)

Description: Mains-powered carbon monoxide detector in white plastic housing, packed in a cardboard box.

Batch number / Barcode: 8718868450104; ELC51010696

Country of origin: China

Alert submitted by: The Netherlands



Alert number: A12/0521/17

Product: UV nail lamp

Name: UV LAMP Professional Nail Dryer

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: DIAMOND NAILS

Type / number of model: SM – 906

Risk level: Serious risk

The live wire ends of the mains cable are not properly secured. As a consequence, the cable could become loose causing accessible parts to become live. In addition, accessible metal parts are separated with only basic insulation from live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Mains operated nail dryer with white casing. Packaging: cardboard box

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Hungary



Alert number: A12/0524/17

Product: UV nail lamp

Name: UV LAMP

Risk type: Cuts, Electric shock, Fire

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: FMD707

Risk level: Serious risk

The plastic casing is not sufficiently heat resistant and may overheat and catch fire. The accessible metal parts of the UV tubes are separated with only basic insulation from the live parts. The wire ends of the cable are not properly secured and could detach causing them to become accessible or causing accessible metal parts to become live. If an internal short circuit occurred, the fluorescent lamp may explode causing cuts to the user. The warnings supplied with the product are insufficient. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.


Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Mains operated, nail dryer with white casing. Packaging: cardboard box.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Hungary

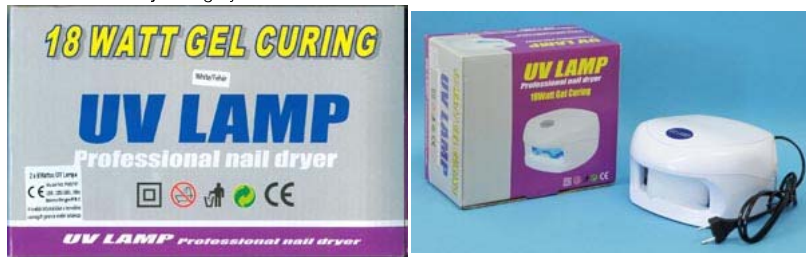

Alert number: A12/0531/17

Product: Ring

Name: Unknown

Risk type: Chemical

Category: Jewellery

Brand: Dyrberg/Kern

Type / number of model: Staray

Risk level: Serious risk

The amount of nickel released by the ring is too high (6,1 µg/cm²/week). Nickel is a strong sensitizer and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product does not comply with the REACH Regulation.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Description: A gold-coloured ring with a decorative flower or star shape on the top.

Batch number / Barcode: 5703885286099

Country of origin: China

Alert submitted by: Denmark



Alert number: A12/0528/17

Product: Indoor lights

Name: Various

Risk type: Injuries

Category: Lighting equipment

Brand: B&Q / Colours

Type / number of model: Various

Risk level: Serious risk

The lampshade rings on some ranges of lights may fracture, allowing the shade to fall from the light fittings. The product does not comply with the requirements of the Low Voltage Directive.

Measures taken by economic operators: Warning consumers of the risks (By: Retailer)

Company recall page:

<http://www.diy.com/customer-support/product-information/product-recall/> (<http://www.diy.com/customer-support/product-information/product-recall/>)

Description: Indoor ceiling lights / wall lights / table lamps

Batch number / Barcode: Various

Country of origin: China

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Ireland







Alert number: A12/0529/17
 Product: Desk lamp
 Name: LED Folding Rechargeable Table Lamp
 Risk type: Electric shock
 Category: Lighting equipment
 Brand: Ling hang zhi xing
 Type / number of model: LHLED 5S and LED-666
 Risk level: Serious risk

The hinge screws of the lamp can be detached without tools leaving basic insulated wires accessible. The basic insulated wires touch the sharp thread of the metal hinge screws. In case of damage to the insulation, the hinge screws, which are accessible to the user, could become live. The dimensions of the plug are such that the user may touch the live pins when plugging the battery charger into a socket outlet. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Black and white foldable, rechargeable portable table lamp with 24 LEDs. A battery charger is attached to the product. Packaging: cardboard box.

Batch number / Barcode: 6 939020 426665

Country of origin: China

Alert submitted by: Hungary



Alert number: A12/0492/17
 Product: Vehicle component
 Name: Unknown
 Risk type: Injuries
 Category: Motor vehicles
 Brand: Starko
 Type / number of model: Type-approval numbers: E4-54R-0031284 Ext 00 // E4-117R-026804-S2WR2 Ext 00.
 Risk level: Serious risk

A defect of the tyre during mounting on the rim can lead to sudden loss of pressure, which may cause rapid deflation (air loss) while in use.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Wheels

Batch number / Barcode: The wheels concerned were produced between 1 April 2016 and 3 March 2017.

Country of origin: Belgium

Alert submitted by: Germany

Alert number: A12/0496/17
 Product: Passenger car
 Name: Boxster, Cayman, 911
 Risk type: Injuries
 Category: Motor vehicles
 Brand: Porsche
 Type / number of model: Type-approval numbers: e13*2007/46*1187*14-15, e13*2007/46*1188*06, e13*2007/46*1607*02-03, e13*KS07/46*0991*00, e13*KS07/46*1613*00. Type: 991, 991 Turbo, 982, 991H, 991R
 Risk level: Serious risk

There is a possibility that the passenger airbags were manufactured with faulty components. This may affect the triggering of the airbags which may result in full protection not being achieved in the event of an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number / Barcode: The vehicles affected were produced from 2016 to 2017.

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: The Netherlands

Alert number: A12/0498/17
 Product: Passenger car
 Name: Boxster, 911
 Risk type: Injuries
 Category: Motor vehicles
 Brand: Porsche
 Type / number of model: Type-approval numbers: e13*2007/46*1187*14-15, e13*2007/46*1188*06, e13*2007/46*1607*02-03; type: 991, 991 Turbo, 982.
 Risk level: Serious risk
 The windscreen might not be correctly bonded to the bodywork. Consequently, there is a possibility that the windscreen could become detached in the event of an accident.
 Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
 Description: Passenger car
 Batch number / Barcode: The vehicles affected were produced between 10 January 2017 and 10 February 2017.
 Country of origin: Germany
 Alert submitted by: Germany
 Products were found and measures were taken also in: The Netherlands

Alert number: A12/0501/17
 Product: Passenger car
 Name: Mazda 5
 Risk type: Injuries
 Category: Motor vehicles
 Brand: Mazda
 Type / number of model: Type approval numbers: e13*2001/116*0156* Type: CR1
 Risk level: Serious risk
 The airbag control module may have been incorrectly configured following the installation of a passenger airbag deactivation switch. As a result, the curtain airbag and the side airbag may not deploy as expected in the event of a side impact.
 Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
 Description: Passenger car
 Batch number / Barcode: The vehicles affected were manufactured between 11 February 2005 and 17 September 2010.
 Country of origin: Japan
 Alert submitted by: Germany
 Products were found and measures were taken also in: The Netherlands

Alert number: A12/0502/17
 Product: Tow rope
 Name: Tow Line
 Risk type: Injuries
 Category: Motor vehicles
 Brand: Hamron
 Type / number of model: Item no. 388-618
 Risk level: Serious risk
 The tow rope is not strong enough and could break during use.
 Measures taken by economic operators: Marking the product with appropriate warnings on the risks (By: Distributor)
 Description: Vehicle tow rope with two steel hooks. Intended for towing vehicles weighing up to 2500 kg. Packed in a plastic bag.
 Batch number / Barcode: 6940902059659
 Country of origin: China
 Alert submitted by: Poland



Alert number: A12/0506/17
Product: Passenger car
Name: Kangoo
Risk type: Injuries
Category: Motor vehicles
Brand: Renault
Type / number of model: X61, e2*2001/116*0364 ext. 39 and 40, e2*2007/46*0006 ext. 34 and 35, e2*2007/46*0089*10
Risk level: Serious risk
 Cracks in the casing of the steering column could lead to fatigue rupture of the casing. This could lead to the controls under the steering wheel (indicators, lights, wipers) becoming jammed and difficult to operate. In case of rupture due to bending in the event of an impact, it could affect the steering.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Passenger car
Batch number / Barcode: Vehicles produced between 8 November 2016 and 9 December 2016 inclusive.
Country of origin: France
Alert submitted by: France
Products were found and measures were taken also in: Ireland, Poland

Alert number: A12/0507/17
Product: Passenger car
Name: Megane
Risk type: Injuries
Category: Motor vehicles
Brand: Renault
Type / number of model: Megane IV GT (BFB); e2*2007/46*0546 ext. 00 à 06
Risk level: Serious risk
 When accelerating sharply, the software does not require adequate pressure to be applied to the clutch which could cause the clutch to overheat. As a result, the vehicle might go into "back-up" mode whilst driving.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Passenger car
Batch number / Barcode: Vehicles concerned were manufactured between the start of production and 23 January 2017.
Country of origin: France
Alert submitted by: France
Products were found and measures were taken also in: Ireland

Alert number: A12/0514/17
Product: Bus
Name: Citaro, CapaCity, Setra, Conecto
Risk type: Injuries
Category: Motor vehicles
Brand: Evobus
Type / number of model: Type-approval numbers: e1*2007/46*0087, e1*2007/46*0090, e1*2007/46*0089, e1*2007/46*0903, e1*2007/46*0097*; types: 628 02, 628 03, 628 04, 628 05, 628 21
Risk level: Serious risk
 When the door action mechanism is disconnected from the power supply, the inward-swinging door has no obstacle detection device via the pressure-wave switch. If a passenger/object happens at that precise moment to be right in the middle of the doorway and is thus not detected as an obstruction, there is a risk that this person/object may become trapped.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Bus
Batch number / Barcode: The vehicles affected were produced between November 2004 and October 2010.
Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/0516/17
Product: Scooter
Name: MP3 Yourban 300 LT and RL
Risk type: Injuries
Category: Motor vehicles
Brand: Piaggio
Type / number of model: EC type-approval numbers for: MP3 Yourban RL: e3*2002/24*0577*00; e3*2002/24*0577*01 for MPR Yourban LT: e3*2002/24*0578*00
Risk level: Serious risk
 The rear brake line has been positioned incorrectly. As a result, it could be damaged/burnt by repeated contact with the catalyser.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Scooter
Batch number / Barcode: Production period 04.2014 – 11.2016
Country of origin: Italy
Alert submitted by: Italy
Products were found and measures were taken also in: The Netherlands

Alert number: A12/0523/17
Product: Passenger car
Name: Boxster, Cayman, 911
Risk type: Fire
Category: Motor vehicles
Brand: Porsche
Type / number of model: EC type-approvals: e13*2007/46*1607*00 - 03, e13*2007/46*1187*12 - 15 Types: 982, 991
Risk level: Serious risk
 The mounting screws for the fuel pipe on the fuel injectors may shear off due to stress corrosion cracking. This could lead to the fuel pipe becoming detached and fuel may leak into the engine compartment.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Passenger car
Batch number / Barcode: The vehicles affected were produced between 7/10/2015 and 26/9/2016.
Country of origin: Germany
Alert submitted by: Germany
Products were found and measures were taken also in: The Netherlands

Alert number: A12/0530/17
Product: Driving system
Name: Unknown
Risk type: Injuries
Category: Motor vehicles
Brand: Joysteer
Type / number of model: JS-DP
Risk level: Serious risk
 Sudden failure of the counterforce on the joystick could occur, leading to over-steering. This could lead to loss of control of the vehicle.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Electronic driving system for people with physical disabilities.
Batch number / Barcode: The components were manufactured between December 2009 and March 2017.
Country of origin: Switzerland
Alert submitted by: Germany

Alert number: A12/0495/17
Product: Gardening gloves
Name: Gartenhadnschuhe ('Gardening gloves')
Risk type: Chemical
Category: Protective equipment
Brand: floraworld
Type / number of model: Item No: 012448
Risk level: Serious risk
 The amount of chromium (VI) in the leather is too high (measured value up to 32 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the requirements of the Personal Protective Equipment Directive and with the REACH Regulation.
Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)
Description: One pair of gardening gloves made of light grey leather parts at the finger tips and palm and purple and white textile material with a flower pattern. Sample size L/9.
Batch number / Barcode: 4047883040965
Country of origin: China
Alert submitted by: Germany



Alert number: A12/0519/17
 Product: Bicycle helmet
 Name: Bicycle helmet RACE
 Risk type: Injuries
 Category: Protective equipment
 Brand: Good Bike / Bottari Europe
 Type / number of model: art. 88849 (XS-T28)
 Risk level: Serious risk

The fastening device breaks easily and the helmet can come off the user's head. As a result, the user might suffer injuries in the event of an impact. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN 1078.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: Bicycle helmet made of plastic material with fastening device. Size: 54-61 cm. Manufactured: 11/2015.

Batch number / Barcode: 8052194888492

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0494/17
 Product: Musical mobile
 Name: Musical Mobile
 Risk type: Choking, Suffocation
 Category: Toys
 Brand: Shengfa Toys
 Type / number of model: CGD-2017-01-13-0006
 Risk level: Serious risk

The removable rattle in the centre of the mobile, when dropped, could release a small metal ball, posing a choking hazard. The plastic bag is too thin and can cover the mouth and/or nose of a child, causing suffocation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Destruction of the product (By: Importer)

Description: Plastic musical baby cot mobile with removable plastic components suspended from cords. The product is sold inside a printed cardboard box.

Batch number / Barcode: X000N691MR

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/0503/17

Product: Rattles

Name: Unknown

Risk type: Choking

Category: Toys

Brand: HABA

Type / number of model: 1.) Greifling Lolli, ref. 300905 and 2.) Greifling Zaubermondes, ref. 301717

Risk level: Serious risk

The connecting element can detach easily, generating a small part that a small child may put in the mouth, causing choking. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Two plastic rattles: one is in the form of two intertwined crescent moons (a blue one and a yellow one) and the other has the form of an orange-coloured lollipop.

Batch number / Barcode: 4010168215327

Country of origin: China

Alert submitted by: Spain

Products were found and measures were taken also in: France, Sweden



Alert number: A12/0504/17

Product: Soft toy

Name: Unknown

Risk type: Chemical, Choking

Category: Toys

Brand: iove mate

Type / number of model: ZL2010202824484

Risk level: Serious risk

The nose and the eye of the toy can be easily detached. The electric device and fibrous stuffing material are easily accessible. A child could put the stuffing material in the mouth and choke on it or remove the button batteries from the device and swallow them, causing damage to the child's gastrointestinal tract. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Soft toy in the shape of a pink kitten dressed in a pink dress, with a zip-fastener at the back and a sound-emitting device.

Batch number / Barcode: Unknown

THE PRODUCT IS COUNTERFEIT

Country of origin: China

Alert submitted by: Iceland



Alert number: A12/0505/17
 Product: Plastic doll
 Name: LOVE FASHION
 Risk type: Chemical
 Category: Toys
 Brand: Unknown
 Type / number of model: NO.7100 (on the box), BO41-B-D-0240-002 (on the label)

Risk level: Serious risk

The plastic material of the doll's head contains di(2-ethylhexyl) phthalate (DEHP) (measured value 35% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Plastic doll with pink hair dressed in a pink top and yellow skirt. Packaging: cardboard box with transparent window.

Batch number / Barcode: 2014113402505

Country of origin: China

Alert submitted by: Hungary



Alert number: A12/0520/17

Product: Doll

Name: Lala [Doll]

Risk type: Chemical

Category: Toys

Brand: Moxie girlz

Type / number of model: YF01C

Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 34.4 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: Plastic doll packed in a box with plastic window. Product size: 21,5 cm.

Batch number / Barcode: 7460801006091

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0522/17
 Product: Fancy-dress costume
 Name: Belly Babies - Petit Kangourou
 Risk type: Choking
 Category: Toys
 Brand: UNDERWRAPS
 Type / number of model: 1) Ref. CS810119/M , 2) Ref. CS810119/L , 3) Ref. CS810119/XL
 Risk level: Serious risk
 The eyes on the head of the costume can easily detach, generating small parts that a child might put in the mouth, causing choking. The fibrous stuffing material is easily accessible due to the weakness of certain seams. The stuffing material may cause choking if put in the mouth by children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.
 Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)
 Description: Kangaroo fancy-dress costume for children aged 2 to 4, packaged in a plastic bag.
 Batch number / Barcode: 1) 897164611278, 2) 897164611285 , 3) 897164611292
 Country of origin: China
 Alert submitted by: France



Alert number: A12/0525/17
 Product: Plastic doll
 Name: Fashion Gril - New Style
 Risk type: Chemical
 Category: Toys
 Brand: Abababy
 Type / number of model: Item NO.8710
 Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 26% by weight) and di-butyl phthalate (DBP) (measured value: 0.2 % by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Plastic doll with pink hair dressed in gold top and blue-gold skirt. Packaging: cardboard box with transparent window.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Hungary



Alert number: A12/0526/17
 Product: Plastic doll set
 Name: Barlin - Special styles
 Risk type: Chemical
 Category: Toys
 Brand: Sailling (Liya)
 Type / number of model: No: ly986 A
 Risk level: Serious risk

The plastic material of the dolls' heads contains di(2-ethylhexyl) phthalate (DEHP) (measured value up to 34% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Withdrawal of the product from the market, Withdrawal of the product from the market (By: Distributor)

Description: Plastic wedding couple dolls. The dolls are fixed to a cardboard sheet and packed in a plastic bag.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Hungary



Alert number: A12/0527/17
 Product: Plastic doll
 Name: Beauty Fashion
 Risk type: Chemical
 Category: Toys
 Brand: Unknown
 Type / number of model: NO.138A
 Risk level: Serious risk

The plastic material of the doll's head contains di(2-ethylhexyl) phthalate (DEHP) (measured value 11% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Plastic doll dressed in a blue and gold-coloured dress. Packaging: cardboard box with transparent window.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Hungary



Alert number: A11/0066/17

Product: Children's bicycle

Name: Unknown

Risk type: Cuts, Injuries

Category: Childcare articles and children's equipment

Brand: Romet

Type / number of model: 1.) Diana 16Y (distributed: 18.09.2014 - 09.06.2016), 2.) Salto 16B (distributed: 18.09.2014 - 10.06.2016), 3.) Diana 16S (distributed: 24.08.2012 - 24.08.2016), 4.) Diana 12 (distributed: 24.08.2012 - 24.08.2016), 5.) Salto 16 (distributed: 01.09.2014 - 15.07.2016), 6.) Salto 12 (distributed: 26.08.2012 - 26.08.2016)

Risk level: Other risk level

The nuts on the cranks have sharp edges. During riding or maintenance of the bicycle, these sharp edges may cut the user's leg or fingers. The bicycle seat posts have a quick-release mechanism which may cause the seat to become unstable during the ride and the child may lose its balance and fall. The product does not comply with the relevant European standard EN 8098.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Children's bicycles equipped with 12" or 16" wheels and additional side wheels (stabilisers), depending on the model.

Batch number / Barcode: 1.)5907782765447, 2.) 5907782765507 , 3.) 5907782765453 , 4.) 5907782765413, 5.) 5907782765491, 6.) 5907782765439 & 5907782765422

Country of origin: China

Alert submitted by: Poland



Alert number: A11/0069/17

Product: Chair

Name: Unknown

Risk type: Injuries

Category: Furniture

Brand: SIGNAL

Type / number of model: H261, colour grey

Risk level: Other risk level

The chair has insufficient stability and strength: the back legs and the connection can break and the user could consequently fall, which can lead to injuries. The product does not comply with the relevant European standard EN 12520.

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures (By: Distributor)

Description: A chair with padded seat and backrest. The legs are made of chrome and of cylindrical form with a diameter max. 25 mm to min. 14 mm. The soft parts are made of latex foam and coated with artificial leather.

Batch number / Barcode: B01043363

Country of origin: China

Alert submitted by: Lithuania



Alert number: A11/0068/17

Product: Bathroom light

Name: Unknown

Risk type: Electric shock

Category: Lighting equipment

Brand: TULA

Type / number of model: Ref.: 90

Risk level: Other risk level

The insulation of the internal wiring could be damaged where it passes through accessible metal parts with sharp edges. This could lead to the accessible metal parts becoming live. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: Bathroom light, 28W.

Batch number / Barcode: 8421676009074; Batch: 874/2012

Country of origin: China

Alert submitted by: Spain



Alert number: A11/0067/17

Product: Toy drum

Name: My First Band

Risk type: Damage to hearing

Category: Toys

Brand: COLOR BABY

Type / number of model: model 586-1C, ref. 24,143

Risk level: Other risk level

The peak sound pressure level of the toy drum is too high. The product does not meet the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market (By: Importer)

Description: Metallic coloured toy drum, incorporating a transparent part which reads "MY FIRST BAND". It has a pink band and includes two black drumsticks. It comes in a transparent plastic bag sealed by a cardboard strip.

Batch number / Barcode: 8412842241435; lot 1402816

Country of origin: China

Alert submitted by: Spain

