



European Commission (http://ec.europa.eu/index_en.htm) Consumers (http://ec.europa.eu/consumers/index_en.htm)

Consumers safety (http://ec.europa.eu/consumers/consumers_safety/index_en.htm)

Safety products (http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm)

🏠 [Rapid Alert System home \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2018\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2018)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search)

👍 [Safe Products Online \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline)

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

week 3 - 2018

RAPEX notification A12/1411/17 of Report-2017-042 has been withdrawn at the request of the notifying authority following a revised risk assessment.

Alert number: A12/0028/18

Product: Tattoo ink

Name: Bright Red

Risk type: Chemical

Category: Chemical products

Brand: Intenze

Type / number of model: Unknown

Risk level: Serious risk

The product contains the aromatic amine o-anisidine (measured value 26 mg/kg).

Aromatic amines can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic, mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent make-up products nor released from azo-colourants.

The product does not comply with the national legislation.

Measures ordered by public authorities (to: Importer): Ban on the marketing of the product and any accompanying measures

Description: 29.6 ml bottle of red pigment

Batch number / Barcode: Batch number SS241

Country of origin: United States

Alert submitted by: Italy



Alert number: A12/0034/18

Product: Tattoo ink

Name: DARK RED

Risk type: Chemical

Category: Chemical products

Brand: Eternal Ink

Type / number of model: Unknown

Risk level: Serious risk

The product contains the aromatic amine o-anisidine (measured value: 18 mg/kg).

Aromatic amines can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic, mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent make-up products nor released from azo-colourants.

The product does not comply with the national legislation.

Measures ordered by public authorities (to: Importer): Ban on the marketing of the product and any accompanying measures

Description: Red tattoo ink

Batch number / Barcode: Batch Number 11.06.15

Country of origin: United States

Alert submitted by: Italy



Alert number: A12/0035/18

Product: Tattoo ink

Name: Lighting Yellow

Risk type: Chemical

Category: Chemical products

Brand: Eternal Ink

Type / number of model: Unknown

Risk level: Serious risk

The product contains the aromatic amines o-anisidine (measured value: 97 mg/kg) and toluidine (measured value: 126 mg/kg). Aromatic amines can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic, mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent make-up products nor released from azo-colourants.

The product does not comply with the national legislation.

Measures ordered by public authorities (to: Importer): Ban on the marketing of the product and any accompanying measures

Description: 30-ml bottle of yellow tattoo pigment

Batch number / Barcode: Batch Number 16488

Country of origin: United States

Alert submitted by: Italy



Alert number: A12/0020/18
Product: Children's shorts
Name: Unknown
Risk type: Injuries
Category: Clothing, textiles and fashion items
Brand: URCHIN
Type / number of model: FH6809
Risk level: Serious risk

The cords in the waist area are too long and not fixed to the garment.
 The cords could become trapped during various activities of the child, leading to injuries.

The product does not comply with the relevant European Standard EN 14682.

Measures ordered by public authorities (to: Distributor): Withdrawal of the product from the market
Description: Green and white shorts with the word LOSANGES embroidered on them. No packaging.
Batch number / Barcode: Unknown
Country of origin: Unknown
Alert submitted by: Spain



Alert number: A12/0065/18
Product: Karaoke system
Name: Unknown
Risk type: Electric shock
Category: Communication and media equipment
Brand: Singing Machine
Type / number of model: SML385BTW
Risk level: Serious risk

It is possible to incorrectly insert only one pin of a normal power plug into the plug adapter.
 The other pin will then be live and can cause an electric shock.

Measures taken by economic operators: Other, Recall of the product from end users (By: Distributor)
Description: Karaoke machine with speakers and a microphone. Supplied with a plug adaptor.
Batch number / Barcode: SM002-17, SM031-17, SM032-17, SM033-17 / 5025087001318
Country of origin: Unknown
Alert submitted by: Denmark



Alert number: A12/0023/18

Product: Hairdryer

Name: Suszarka do Wlosow

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Sapir

Type / number of model: SP-1100-CJ

Risk level: Serious risk

The rated current of the plug is not sufficient.

The current drawn by the hairdryer could damage the plug causing live parts to become accessible.

Measures taken by economic operators: Withdrawal of the product from the market (By: Manufacturer)

Description: Electric hairdryer. Packaging: cardboard box.

Batch number / Barcode: 4895139226683

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0026/18

Product: Remote control plugs

Name: Remote control on/off set

Risk type: Electric shock, Fire

Category: Electrical appliances and equipment

Brand: GAO

Type / number of model: EMW203R-UK

Risk level: Serious risk

The fuse does not operate correctly.

As a result, the product can overheat when overloaded causing melting of the plastic enclosure. This can lead to a fire or to live components being exposed.

The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Company recall page:

<http://www.diy.com/customer-support/product-information/product-recall/> (<http://www.diy.com/customer-support/product-information/product-recall/>)

Description: Remote control on/off plug socket set. Twin or triple set contained in plastic and cardboard pack.

Batch number / Barcode: Triple pack set – 4895130705675, Twin pack set – 5052931395033

Country of origin: China

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Ireland



Alert number: A12/0027/18

Product: Power supply

Name: AC Adapter

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: HNN-12V1

Risk level: Serious risk

The electrical insulation is insufficient. The creepage and clearance distances between the primary and secondary circuits are too small. This could lead to the user receiving an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61558.


Measures ordered by public authorities (to: Importer): Recall of the product from end users

Description: Power supply for LED light, sold in a white cardboard box.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Finland

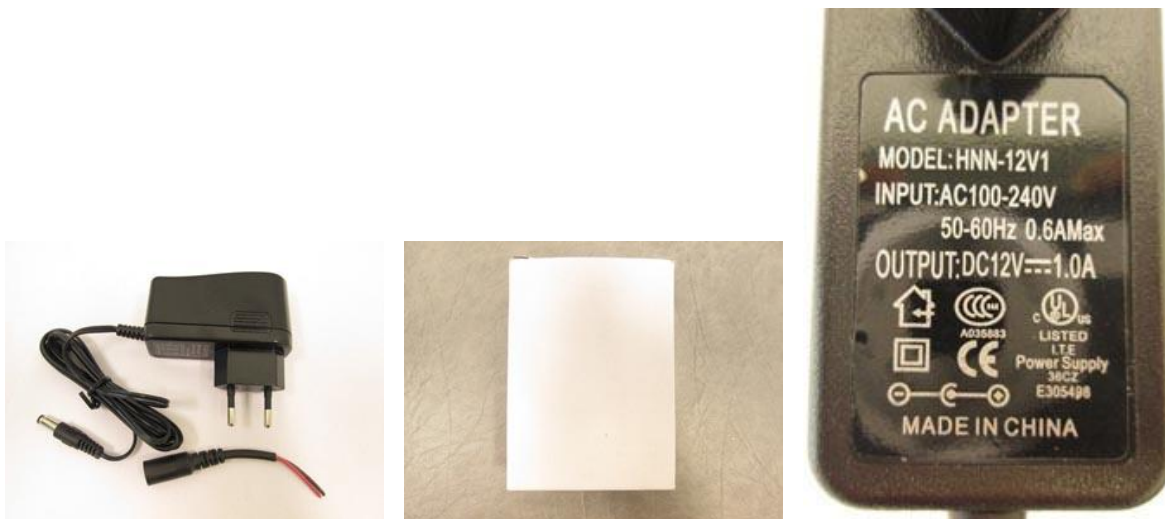

Alert number: A12/0029/18

Product: Insect killer lamp

Name: DESTRUCTEUR D'INSECTES

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: Code 281658-LJ3W-011

Risk level: Serious risk

The lamp's high voltage grills are easily accessible by users.

Users could touch these accessible parts and suffer an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Insect killer lamp in cardboard packaging.

Batch number / Barcode: 2070002556193

Country of origin: China

Alert submitted by: France



Alert number: A12/0050/18

Product: Hair trimmer

Name: AcuBlade Lithium

Risk type: Fire

Category: Electrical appliances and equipment

Brand: BaByliss

Type / number of model: 7426U

Risk level: Serious risk

The lithium battery in the hair trimmer may overcharge.

Overcharging of the battery could lead to thermal runaway and the risk of a fire.

The product does not comply with the relevant European standard EN 62133-2.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Company recall page:

<https://www.babyliss.co.uk/7426u-recall.html> (<https://www.babyliss.co.uk/7426u-recall.html>)

Description: Hair trimmer packaged in a cardboard box.

Batch number / Barcode: Only a single batch is affected: 2416PT2

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/0049/18

Product: Golf glove

Name: Aeroburner Glove

Risk type: Chemical

Category: Hobby/sports equipment

Brand: Aeroburner, TaylorMade

Type / number of model: Unknown

Risk level: Serious risk

The amount of chromium (VI) in the leather is too high (measured value up to 5.27 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions.

The product does not comply with REACH Regulation.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

Description: Leather white and red golf glove. Comes in the following sizes: S, M, L, XL, ML

Batch number / Barcode: B1162019, B1162020, B1162021, B1162022, B1162023, B1162119, B1162120, B1162121, B1162122, B1162123, B1162124, B1162219, B1162220, B1162221, B1162222, B1162223

Country of origin: Indonesia

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Poland, Sweden, The Netherlands



Alert number: A12/0017/18

Product: LED Light

Name: Party LED Lights GETX LED

Risk type: Environment

Category: Lighting chains

Brand: Party Lighting

Type / number of model: ITEM NO 88029

Risk level: Serious risk

Some plastic or rubber components contain SCCPs (measured value up to 1.1%).

The placing on the market and use of articles containing SCCPs is banned. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment.

The product does not comply with the Regulation on persistent organic pollutants (POP Regulation).

Measures taken by economic operators: Withdrawal of the product from the market (By: Retailer)

Description: Black cord with light bulbs in different colours. Packed in a 40 cm long cardboard box.

Batch number / Barcode: 8711252880297

Country of origin: China

Alert submitted by: Norway

Products were found and measures were taken also in: The Netherlands



Alert number: A12/0045/18

Product: Transport/utility vehicle

Name: Various models

Risk type: Injuries

Category: Machinery

Brand: John Deere

Type / number of model: Gator XUV825, XUV825 S4, XUV855, XUV855 S4 Crossover

Risk level: Serious risk

The steering box may malfunction under certain circumstances.

This can make the vehicle difficult to control.

The product does not comply with the requirements of the Machinery Directive.

Measures taken by economic operators: Recall of the product from end users, Recall of the product from end users (By: Manufacturer)

Measures ordered by public authorities: Recall of the product from end users

Description: Transport/utility vehicle

Batch number / Barcode: Period of manufacture: March 2012 to November 2017

Country of origin: United States

Alert submitted by: Germany



Alert number: A12/0018/18**Product:** Bus**Name:** A3, AG3, AGG3**Risk type:** Injuries**Category:** Motor vehicles**Brand:** Van Hool**Type / number of model:** Approval No: e6*2007/46*0021*03; national U/70164, U/70077, 97/1143; Individual approval type: 30XB, 3X0B, 318, 324**Risk level:** Serious risk

When the door action mechanism is disconnected from the power supply, the inward-swinging door has no obstacle detection device via the pressure-wave switch.

There is a greater risk of injury when getting into or stepping out of the bus. Passengers could be trapped in the door.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)**Description:** Bus**Batch number / Barcode:** The vehicles concerned were manufactured between 2005 and 2013.**Country of origin:** Belgium**Alert submitted by:** Germany**Alert number:** A12/0019/18**Product:** Passenger car**Name:** Mazda 6**Risk type:** Injuries**Category:** Motor vehicles**Brand:** Mazda**Type / number of model:** Type-approval numbers: e1*2007/46*1001*01, e1*2001/116*0448*14, e1*2001/116*0448*19; type: GJ, GH**Risk level:** Serious risk

Water infiltration may affect the functionality of the parking brake.

Reduced holding power of the parking brake could lead to an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)**Description:** Passenger car**Batch number / Barcode:** The vehicles concerned were produced between 31 July 2012 and 18 November 2014.**Country of origin:** Japan**Alert submitted by:** Germany**Products were found and measures were taken also in:** Bulgaria, Croatia, Estonia, Finland, Iceland, Poland, Slovakia, Slovenia, Sweden**Alert number:** A12/0021/18**Product:** Passenger car**Name:** Mii**Risk type:** Injuries**Category:** Motor vehicles**Brand:** SEAT**Type / number of model:** Unknown**Risk level:** Serious risk

The towing eye supplied with the car may have defective welding.

If the towing eye is used, it may break with the risk that the towing cable hits people.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)**Description:** Passenger car**Batch number / Barcode:** Manufactured between 18/05/2017 and 12/10/2017.**Country of origin:** Spain**Alert submitted by:** Spain**Products were found and measures were taken also in:** Denmark, Finland, Greece, Poland, Slovenia, Sweden, The Netherlands**Alert number:** A12/0041/18**Product:** Pickup truck**Name:** Amarok**Risk type:** Fire, Injuries**Category:** Motor vehicles**Brand:** VW**Type / number of model:** Type-approval numbers: e1*2007/46*0356* e1*2007/46*0750* Type: 2H, 2HS2**Risk level:** Serious risk

The servo return pipe to the steering box could be damaged by a hose clamp and/or by coming into contact with the body of the wheel housing.

A damaged pipe could leak hydraulic oil on to hot components or the brake disk, leading to the risk of a fire or an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)**Description:** Pickup truck**Batch number / Barcode:** The vehicles affected were produced between 19/12/2015 and 24/11/2017.**Country of origin:** Argentina, Germany**Alert submitted by:** Germany**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Estonia, Finland, Greece, Slovenia, Sweden, The Netherlands

Alert number: A12/0042/18

Product: Passenger car

Name: Various models

Risk type: Injuries

Category: Motor vehicles

Brand: Peugeot

Type / number of model: 2008 : e2*2007/46*0070*39 , 208 : e2*2007/46*0070*39, 3008 II : e2*2007/46*0534*02, e2*2007/46*0534*04, 308 II : e2*2007/46*0405*16, e2*2007/46*0405*17, 5008 II : e2*2007/46*0534*04, 508 : e2*2007/46*0080*34, e2*2007/46*0081*18 , Partner III : e2*2001/116*0365*30, e2*2001/116*0365*31, e2*2007/46*0001*27, e2*2007/46*0001*28

Risk level: Serious risk

An engine part may not work correctly, leading to power loss.

This could potentially result in the engine stalling or engine failure. In very rare circumstances, the vehicle may unexpectedly accelerate slightly before suddenly stopping.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number / Barcode: 2008: manufactured between 2/10/2017 and 20/11/2017, 208: manufactured between 4/10/2017 and 27/11/2017, 3008 II: manufactured between 21/8/2017 and 26/11/2017 , 308 II: manufactured between 2/10/2017 and 23/11/2017 , 5008 II: manufactured between 4/10/2017 and 24/11/2017 , 508: manufactured between 6/10/2017 and 23/11/2017, Partner III: manufactured between 4/10/2017 and 22/11/2017

Country of origin: France

Alert submitted by: France

Products were found and measures were taken also in: Croatia, Estonia, Finland, Greece, Ireland, Malta, Poland, Slovenia, Sweden, The Netherlands

Alert number: A12/0043/18

Product: Passenger car

Name: 3008 II

Risk type: Injuries

Category: Motor vehicles

Brand: Peugeot

Type / number of model: e2*2007/46*0534*00, e2*2007/46*0534*01, e2*2007/46*0534*02, e2*2007/46*0534*03, e2*2007/46*0534*04, e2*2007/46*0534*05

Risk level: Serious risk

There is contact between a fuel hose and the aerodynamic screen located under the fuel tank. Over time, this could cause a fuel leak.

Fuel leakage onto the road could cause another vehicle to lose control.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number / Barcode: Vehicles manufactured between 5/4/2016 and 24/8/2017

Country of origin: France

Alert submitted by: France

Products were found and measures were taken also in: Croatia, Estonia, Finland, Greece, Ireland, Malta, Poland, Slovenia, Sweden, The Netherlands

Alert number: A12/0044/18

Product: Passenger car

Name: i40

Risk type: Injuries

Category: Motor vehicles

Brand: Hyundai

Type / number of model: Type-approval number: E4*2007/46*0263*12; Type: VF

Risk level: Serious risk

The clutch switch may be faulty.

As a consequence, if the vehicle is started when it is in gear, without the hand brake on and the clutch not engaged, the vehicle could move off when not expected causing an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car

Batch number / Barcode: The vehicles concerned were manufactured between 1/04/2011 and 26/03/2012.

Country of origin: Republic of Korea

Alert submitted by: Germany

Products were found and measures were taken also in: Bulgaria, Croatia, Estonia, Finland, Iceland, Ireland, Luxembourg, Poland, Slovakia, Slovenia, Sweden, The Netherlands

Alert number: A12/0046/18
Product: Passenger car
Name: Chiron
Risk type: Injuries
Category: Motor vehicles
Brand: Bugatti
Type / number of model: Type-approval number: e1*KS07/46*0008*05; Type: 5B
Risk level: Serious risk
The welding on the seat backs could be faulty.
This could lead to the seats becoming loose.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Passenger car
Batch number / Barcode: The vehicles affected were produced between 2 February 2017 and 13 October 2017.
Country of origin: France
Alert submitted by: Germany
Products were found and measures were taken also in: The Netherlands

Alert number: A12/0047/18
Product: Van
Name: T6
Risk type: Injuries
Category: Motor vehicles
Brand: VW
Type / number of model: 7J0 (goods vehicle registration) e1*2007/46*0130*, 7HMA (motor caravan registration) e1*2001/116*0289, 7HC (passenger car registration)
Risk level: Serious risk
Due to a manufacturing fault, the fuel hoses may begin to leak.
A fuel leak could pose a hazard to vehicles following behind.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Van
Batch number / Barcode: The vehicles affected were produced between 28/11/2016 and 11/01/2017.
Country of origin: Germany
Alert submitted by: Germany
Products were found and measures were taken also in: Bulgaria, Croatia, Denmark, Finland, Iceland, Ireland, Slovenia, Sweden, The Netherlands

Alert number: A12/0056/18
Product: Motorcycle
Name: Versys-X 300
Risk type: Injuries
Category: Motor vehicles
Brand: Kawasaki
Type / number of model: Type-approval number: e4*168/2013*00049*00; Type: LE300C
Risk level: Serious risk
Because of vibrations, the socket of the brake/rear-light bulb may fall out of the lamp assembly, resulting in failure of the rear light.
If the rear lights fail, the vehicle is no longer adequately visible from the rear, especially when visibility is poor.
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)
Description: Motorcycle
Batch number / Barcode: Vehicles produced during 2017 are affected.
Country of origin: Thailand
Alert submitted by: Germany
Products were found and measures were taken also in: Croatia, Denmark, Estonia, Finland, Greece, Iceland, Luxembourg, Poland, Slovenia, Sweden, The Netherlands

Alert number: A12/0025/18

Product: High visibility vest

Name: Kamizelka dla dzieci

Risk type: Injuries

Category: Protective equipment

Brand: Kando Plus

Type / number of model: UU, UU 204, YOYO-K

Risk level: Serious risk

The reflectance of the vest is inadequate.

As a result, the user is not sufficiently visible in situations where high visibility is essential.

The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN 1150.

Measures ordered by public authorities (to: Importer): Withdrawal of the product from the market

Description: High visibility vest for children. Packed in a transparent plastic bag.

Batch number / Barcode: 5905033227590, 5905033227613, 5905033227620

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0048/18

Product: Firework

Name: Panic

Risk type: Burns, Damage to hearing, Injuries

Category: Pyrotechnic articles

Brand: Panda Feuerwerk

Type / number of model: Article No GP3062

Risk level: Serious risk

The firework battery is unstable and can fall over during burning, meaning that the individual fireworks shoot out in unintended directions. The sound pressure level is too high and can cause damage to hearing.

The product does not comply with the requirement of the Pyrotechnics Directive and the relevant European standard EN 15947.

Measures ordered by public authorities (to: Retailer): Recall of the product from end users

Description: Firework battery with 12 rounds in cardboard packaging.

Batch number / Barcode: CE 1008-F2-69243516

Country of origin: Unknown

Alert submitted by: Austria



Alert number: A12/0058/18

Product: Fireworks

Name: BPATA

Risk type: Burns, Fire

Category: Pyrotechnic articles

Brand: PAKETA

Type / number of model: P2950

Risk level: Serious risk

The rocket is not stable and may shoot in the wrong direction causing injuries or burns.
In some cases burning pieces fall off from the fireworks.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Measures ordered by public authorities (to: Importer): Destruction of the product

Description: Firework rocket

Batch number / Barcode: 4606005729500

Country of origin: China

Alert submitted by: Iceland



Alert number: A12/0059/18

Product: Fireworks

Name: Secret gift

Risk type: Burns, Fire

Category: Pyrotechnic articles

Brand: Unknown

Type / number of model: CF1601

Risk level: Serious risk

The time measured between the ignition of the firework and the explosion of the firework is too short.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Measures ordered by public authorities (to: Importer): Destruction of the product

Description: Colourful paper packaging, with drawing of a green/orange mosquito and the words "25 shots, Secret Gift" on it.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Iceland



Alert number: A12/0060/18

Product: Fireworks

Name: Stormur

Risk type: Burns, Injuries

Category: Pyrotechnic articles

Brand: Unknown

Type / number of model: CF1601

Risk level: Serious risk

The cake is not stable during function and may fall over. The ignition fuse burns to fast .

As a result, the user may get injured or burnt.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Measures ordered by public authorities (to: Importer): Other

Description: Black paper packaging, with gold stripes and the words "GAEDASKOTKOKUR, SKOTKOKUR / HEIMSKLASSA" on it.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Iceland



Alert number: A12/0022/18

Product: Plastic doll

Name: modelka

Risk type: Chemical

Category: Toys

Brand: Natalia Collection

Type / number of model: LS10052

Risk level: Serious risk

The plastic material of the head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 20.8% by weight).

This phthalate may harm the health of children, causing possible damage of the reproductive system.

According to the REACH Regulation the phthalate DEHP is prohibited in all toys and childcare articles.


Measures taken by economic operators: Ban on the marketing of the product and any accompanying measures (By: Retailer)

Description: Plastic doll dressed in a black dress, packed in a cardboard box with window.

Batch number / Barcode: 5908445787232

Country of origin: China

Alert submitted by: Estonia

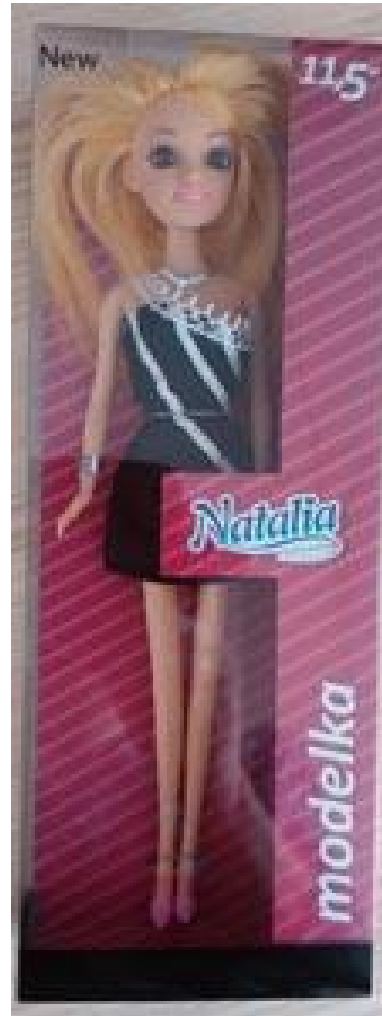

Alert number: A12/0030/18
Product: Trampoline
Name: LS-T185-PA6 Deluxe
Risk type: Injuries
Category: Toys
Brand: Lifestyle ProAktiv
Type / number of model: LS-T185-PA6
Risk level: Serious risk

The product is not sufficiently stable and the safety information, instructions for assembly and warnings are not adequate. As a consequence, the trampoline might tip over during use and the user does not have the relevant information for a safe use of the product, leading to injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-14.


Measures taken by economic operators: Withdrawal of the product from the market

Description: Garden trampoline, diameter 185 cm, with safety net.

Batch number / Barcode: Product ID 10000

Country of origin: Germany

Alert submitted by: France

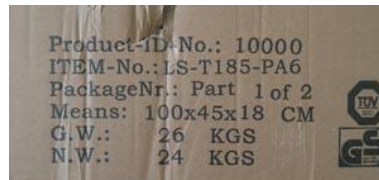

Alert number: A12/0031/18
Product: Plastic doll
Name: Sparkle girl
Risk type: Chemical, Environment
Category: Toys
Brand: Unknown
Type / number of model: No.6669 ITEM NO: 39754
Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 28.5% by weight), di-butyl phthalate (DBP) (measured value: 1.73% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system. It also contains di-isononyl phthalate (DINP) (measured value: 0.81% by weight).

The product does not comply with the requirements of the REACH Regulation.

In addition, it contains short chain chlorinated paraffins (SCCP) (measured value 0.19% by weight). The placing on the market and use of articles containing SCCPs is banned. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment.

The product does not comply with the Regulation on persistent organic pollutants (POP Regulation).

Measures ordered by public authorities (to: Retailer): Ban on the marketing of the product and any accompanying measures, Warning consumers of the risks

Description: Plastic doll with blond hair wearing an orange and golden dress and packed in a cardboard box with a transparent window.

Batch number / Barcode: 7521890397542

Country of origin: China

Alert submitted by: Slovakia



Alert number: A12/0032/18

Product: Plastic doll

Name: Sweet Fashion Style

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: No:Q16

Risk level: Serious risk

The plastic material of the doll contains bis(2-ethylhexyl) phthalate (DEHP) (measured value 26.7% by weight) and dibutyl phthalate (DBP) (measured value 0.29 % by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system.

It also contains di-isononyl phthalate (DINP) (measured value 0.79 % by weight).

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Distributor): Recall of the product from end users, Withdrawal of the product from the market

Description: Plastic doll with blond hair and pink dress. Packed in a cardboard box with a transparent window.

Batch number / Barcode: 6991200161612

Country of origin: China

Alert submitted by: Slovakia



Alert number: A12/0033/18

Product: Plastic doll

Name: LITTLE GIRL

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: Unknown

Risk level: Serious risk

The plastic material of the doll contains bis(2-ethylhexyl)phthalate (DEHP) (measured value 0.2% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Ban on the marketing of the product and any accompanying measures

Description: A small plastic doll, packed in a cardboard box with a transparent window.

Batch number / Barcode: 5901271410749, LOT NO:4975

Country of origin: China

Alert submitted by: Slovakia



Alert number: A12/0036/18

Product: Plastic doll

Name: Girl

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: NO:Q18 NGTC493296

Risk level: Serious risk

The plastic material of the doll contains bis(2-ethylhexyl)phthalate (DEHP) (measured value 25.4% by weight) and dibutylphthalate (DBP) (measured value 0.06 % by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system.

It also contains diisononylphthalate (DINP) (measured value 0.26 % by weight).

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Distributor): Recall of the product from end users, Withdrawal of the product from the market

Description: A plastic doll with blond hair dressed in an orange dress with white flowers. Packed in a cardboard box with a transparent window.

Batch number / Barcode: 6991204932966

Country of origin: China

Alert submitted by: Slovakia

Products were found and measures were taken also in: Poland



Alert number: A12/0037/18

Product: Trampoline

Name: Exit twist

Risk type: Injuries

Category: Toys

Brand: Exit toys

Type / number of model: Exit twist 366 green 12.91.12.01 3/3

Risk level: Serious risk

The distance between two adjacent shock-absorbing pieces of material within the padding is too big and the safety information and warnings are inadequate.

Users do not have the necessary information for a safe use of the product or could fall on the part that is not shock absorbent and be injured.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-14.

Measures taken by economic operators: Withdrawal of the product from the market

Description: Trampoline with safety net.

Batch number / Barcode: 2015DS009-2 / 8718469464975

Country of origin: China

Alert submitted by: France

Products were found and measures were taken also in: Denmark



Alert number: A12/0038/18

Product: Plastic doll

Name: Beautiful doll

Risk type: Chemical

Category: Toys

Brand: BABY HOME

Type / number of model: NO.530 ITEM NO: ZY-7638

Risk level: Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 35.2% by weight), di-butyl phthalate (DBP) (measured value: 0.01% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system. It also contains di-isononyl phthalate (DINP) (measured value: 0.006 % by weight).

The product does not comply with the requirements of the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Ban on the marketing of the product and any accompanying measures, Warning consumers of the risks

Description: Plastic doll packed in a cardboard box with a transparent window.

Batch number / Barcode: 6912080876380

Country of origin: China

Alert submitted by: Slovakia



Alert number: A12/0039/18

Product: Plastic doll

Name: BEAUTIFUL GIRL FASHION

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: NO: 6805 ITEM NO: ZY-7614

Risk level: Serious risk

The plastic material of the doll contains bis (2-ethylhexyl)phthalate (DEHP) (measured value 16.6% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Distributor, Retailer): Ban on the marketing of the product and any accompanying measures, Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

Description: A plastic doll, packed in a cardboard box with a transparent window.

Batch number / Barcode: 6912080876144

Country of origin: China

Alert submitted by: Slovakia



Alert number: A12/0040/18

Product: Plastic doll

Name: Unknown

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: ITEM NO: ZY-7613

Risk level: Serious risk

The plastic material of the doll contains bis(2-ethylhexyl) phthalate (DEHP) (measured value 22.5% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.



Measures ordered by public authorities (to: Importer): Recall of the product from end users, Withdrawal of the product from the market

Description: A plastic doll with blond hair dressed in blue dress. Packed in a yellow cardboard cone.

Batch number / Barcode: 6912080876137

Country of origin: China

Alert submitted by: Slovakia

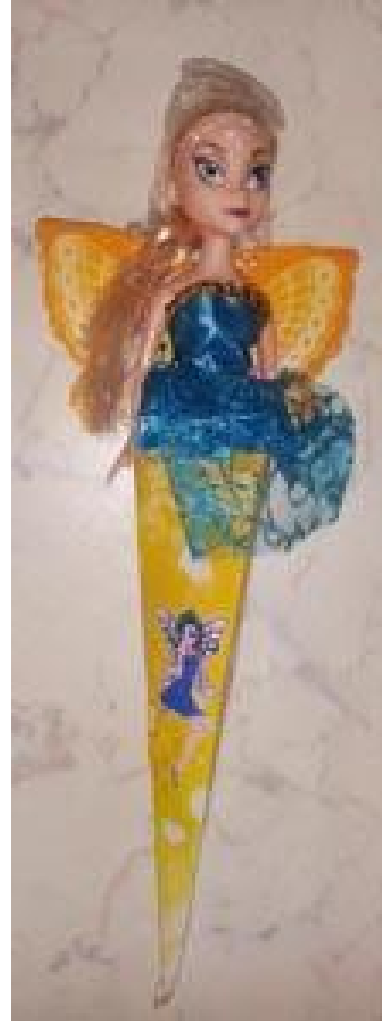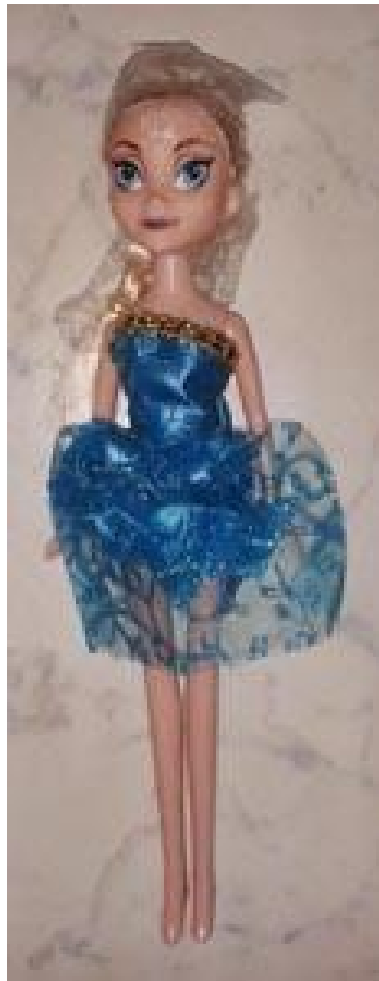

Alert number: A12/0051/18

Product: Fancy-dress costume

Name: Little panda

Risk type: Choking

Category: Toys

Brand: Belly babies UNDERWRAPS

Type / number of model: CS810107/M CS810107/L CS810107/XL

Risk level: Serious risk

The product contains small parts or fibrous stuffing material that can easily be detached.

The small parts or stuffing may be put in the mouth by a small child, causing choking.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Panda costume for children comprising plush bodysuit, hood and booties.

Batch number / Barcode: 1.) 897164581373, 2.) 897164581380 , 3.) 897164581397

Country of origin: China

Alert submitted by: France



Alert number: A12/0052/18

Product: Fancy-dress mask

Name: Masque Squelette Rigide

Risk type: Burns

Category: Toys

Brand: JOJA

Type / number of model: HAL 311

Risk level: Serious risk

The mask is highly flammable.

If it catches fire, the user may suffer burns to the face.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-2.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Golden or pink-coloured 'skeleton' mask with a black veil.

Batch number / Barcode: 352471016846; CH7070-0364-01

Country of origin: China

Alert submitted by: France



Alert number: A12/0053/18

Product: Plastic doll

Name: Little Baby Doll

Risk type: Chemical

Category: Toys

Brand: Funny Toy

Type / number of model: 8001D/HWAS18942

Risk level: Serious risk

The plastic material of the doll's head contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 22.9% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: Plastic baby doll packed in a pink cardboard box with a picture of a child girl giving lap to the baby doll. The doll and accessories (scissors, stethoscope) are visible.

Batch number / Barcode: Batch: 12690393602; EAN: 5609801069039.

Country of origin: China

Alert submitted by: Portugal



Alert number: A12/0054/18

Product: Plastic doll

Name: PERFECT DESIGN

Risk type: Chemical

Category: Toys

Brand: SEMPREVIVA

Type / number of model: S21763 - mkf449373 - 2289 - 12

Risk level: Serious risk

The plastic material of the doll contains di (2-ethylhexyl) phthalate (DEHP) (measured value 30.2% by weight). This phthalate may harm the health of children, causing possible damage of the reproductive system.

The product does not comply with the REACH Regulation.


Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Plastic doll in a cardboard box with transparent plastic window.

Batch number / Barcode: 5605340190272

Country of origin: China

Alert submitted by: Spain

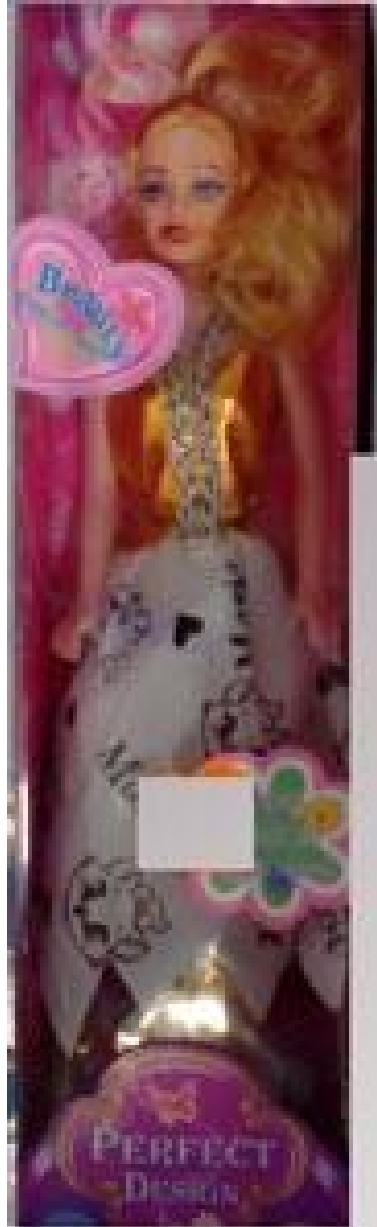

Alert number: A12/0055/18

Product: Plastic doll

Name: THE LOVELY BABY

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: NO.1022A

Risk level: Serious risk

The plastic material of the product contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 27.5 % by weight). This phthalate may harm the health of children, causing possible damage of the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Plastic doll about 10 cm tall, packaging – paper box with transparent window, 3+age.

Batch number / Barcode: 6 910268 015064, 8572 020000 048 , LT 1506

Country of origin: China

Alert submitted by: Czech Republic

Products were found and measures were taken also in: Slovakia



Alert number: A12/0057/18

Product: Plastic doll

Name: my first

Risk type: Chemical

Category: Toys

Brand: Fashion

Type / number of model: NO.958

Risk level: Serious risk

The plastic material of the product contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 11.5 % by weight). This phthalate may harm the health of children, causing possible damage of the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: The doll is 22cm tall, long hair and dress in different colors, 3+age.

Batch number / Barcode: 6934052580859 , VTV3405-25

Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0061/18

Product: Keychain

Name: Keychain mermaid

Risk type: Chemical

Category: Toys

Brand: Toi-Toys

Type / number of model: 110778

Risk level: Serious risk

The plastic material of the toy contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 34% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Ban on the marketing of the product and any accompanying measures

Description: Keychain with a small plastic mermaid attached

Batch number / Barcode: 8714627340600

Country of origin: The Netherlands

Alert submitted by: Luxembourg



Alert number: A12/0062/18
Product: Flashing Bracelet
Name: Flashing Bracelets
Risk type: Chemical, Environment
Category: Toys
Brand: Toys
Type / number of model: 034133

Risk level: Serious risk

The plastic material of the bracelets contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 40% by weight). This phthalate may harm the health of children causing possible damage to the reproductive system.

In addition, the concentration of mercury in the button batteries in the article (0.16 % by weight). Mercury is one of the most hazardous environmental toxins and is a threat to the environment and, through the environment, to human health.

The product does not comply neither with the REACH Regulation nor with the Directive 2006/66 on batteries and accumulators and waste batteries and accumulators.

Measures ordered by public authorities (to: Retailer): Ban on the marketing of the product and any accompanying measures

Description: Plastic, flashing bracelet in plastic packaging

Batch number / Barcode: 8713219322901

Country of origin: The Netherlands

Alert submitted by: Luxembourg

Products were found and measures were taken also in: The Netherlands



Alert number: A12/0063/18

Product: Teether book

Name: Jazzy Jungley

Risk type: Chemical

Category: Toys

Brand: Playgro

Type / number of model: 0m +

Risk level: Serious risk

The fabric material of the book contains the flame retardant tris(2-chlor-1-methylethyl phosphate (TCPP) (measured value: 22950 mg/kg). TCPP can be harmful to children due to its carcinogenic properties and acute toxicity.

The product does not comply with the requirements of the Toy Safety Directive.

Measures taken by economic operators: Withdrawal of the product from the market (By: Distributor)

Measures ordered by public authorities (to: Distributor): Ban on the marketing of the product and any accompanying measures

Description: Teething toy in the shape of a soft book with squeaky ball and plastic handle. Packaging: fixed to a cardboard label.

Batch number / Barcode: 9321104838582, Batch stamped: 005475; ITEM#0183858

Country of origin: China

Alert submitted by: Germany

Products were found and measures were taken also in: Luxembourg, The Netherlands



Alert number: A12/0064/18

Product: Trampoline

Name: Sixjump CST 185/L1564

Risk type: Injuries

Category: Toys

Brand: Sixbros

Type / number of model: 185/6FT TB 185/Blue/ON

Risk level: Serious risk

The product is not sufficiently stable and the safety information, instructions for assembly and warnings are not adequate.

As a consequence, the trampoline might tip over during use and the user does not have the relevant information for a safe use of the product, leading to injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-14.

Measures taken by economic operators: Withdrawal of the product from the market

Description: Blue garden trampoline, size 185 cm

Batch number / Barcode: RKS-2015001

Country of origin: Germany

Alert submitted by: France



Alert number: A11/0004/18

Product: Jumper cable

Name: Unknown

Risk type: Burns

Category: Motor vehicles

Brand: Unknown

Type / number of model: Rozruchowe cable, 900 Amp

Risk level: Other risk level

The terminal clamps are not fully insulated.

This could lead to an unintended flow of current, leading to a voltage arc and burns to users.

The product does not comply with the relevant national standard.

Measures ordered by public authorities (to: Manufacturer): Ban on the marketing of the product and any accompanying measures

Description: Jumper cable, starter cable for passenger vehicles and lorries, 900 Amp with carry bag. Jumper cable, branded cable 2 x 6 meters, for all 12 V batteries .

Batch number / Barcode: 5 900 768 423514

Country of origin: Poland

Alert submitted by: Germany



Alert number: A11/0005/18

Product: Fancy-dress costume

Name: Little monkey

Risk type: Choking

Category: Toys

Brand: Belly babies UNDERWRAPS

Type / number of model: CS810115/XL CS810115/M CS810115/L

Risk level: Other risk level

The fibrous stuffing material is accessible due to the weakness of certain seams.

A child can put the fibrous stuffing material in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Monkey costume for children comprising plush bodysuit, hood and booties.

Batch number / Barcode: 1.) 897164611681, 2.) 897164611674, 3.) 897164611681

Country of origin: China

Alert submitted by: France

