



European Commission ([http://ec.europa.eu/index\\_en.htm](http://ec.europa.eu/index_en.htm)) Consumers ([http://ec.europa.eu/consumers/index\\_en.htm](http://ec.europa.eu/consumers/index_en.htm))

Consumers safety ([http://ec.europa.eu/consumers/consumers\\_safety/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/index_en.htm))

Safety products ([http://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm))

🏠 [Rapid Alert System home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2018\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2018)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search)

👍 [Safe Products Online \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=SafeProductsOnline\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline)

## The Rapid Alert System for Non-Food Products (RAPEX)

### *RAPEX - Weekly overview report of notifications*

week 15 - 2018

Notification A12/0490/18 from report-2018-014 has been permanently withdrawn from the website as it concerns the same recall notified in notification A12/0221/18.

**Alert number:** A12/0533/18  
**Product:** Children's bicycle  
**Name:** Strawberry  
**Risk type:** Injuries  
**Category:** Childcare articles and children's equipment  
**Brand:** Wildhorse  
**Type / number of model:** 1280361; BMX 12" lány  
**Risk level:** Serious risk  
 The stabiliser wheels are too close to the frame.  
 On uneven ground, this may cause the child to lose balance and fall.

The product does not comply with the relevant European standard EN 8098.

**Measures ordered by public authorities (to: Manufacturer):** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Young children's bicycle with stabiliser wheels. Size: 12".

**Batch number / Barcode:** 5998230309664

**Country of origin:** Hungary

**Alert submitted by:** Hungary



**Alert number:** A12/0541/18  
**Product:** Children's sweatshirt  
**Name:** Unknown  
**Risk type:** Choking  
**Category:** Clothing, textiles and fashion items  
**Brand:** Mix Star Kids Club  
**Type / number of model:** Unknown  
**Risk level:** Serious risk  
 Small rhinestones can easily detach from the sweater.  
 Young children may put them in the mouth and choke.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Pink sweatshirt intended for 2 years old children (92 cm)

**Batch number / Barcode:** Unknown

**Country of origin:** Turkey

**Alert submitted by:** Romania



**Alert number:** A12/0550/18

**Product:** Cushions

**Name:** Unknown

**Risk type:** Fire

**Category:** Clothing, textiles and fashion items

**Brand:** Primark

**Type / number of model:** Product Numbers: No. 167401 No. 4467201 No. 4467701 No. 5912001 No. 5512101-03 No. 97528 No. 4727601 No. 8191201-02 No. 0822101-03 No. 4467001-02 No. 0608803-07 No. 8167401 No. 9752802, 9752806-08

**Risk level:** Serious risk

The material of the cushions is flammable.

The cushions can ignite if exposed to an ignition source for an extended period of time.

The product does not comply with the relevant national standard.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Various decorative cushions

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Ireland

**Products were found and measures were taken also in:** Austria



**Alert number:** A12/0523/18

**Product:** Skin-care product

**Name:** Hydrating Emulsion

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** +B.O

**Type / number of model:** CN. 154186.4

**Risk level:** Serious risk

The product contains mesophilic aerobic bacteria (measured quantity: more than  $10^5$  cfu/ml).

If used on damaged skin or if it comes into contact with the eyes, the product may cause infection or irritation.

The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities (to: Manufacturer):** Withdrawal of the product from the market

**Description:** Moisturising body emulsion. Packaged in a white plastic bottle of 1000 ml, 500 ml and 250 ml.

**Batch number / Barcode:** 8427734003763 , Lots manufactured after July 2017.

**Country of origin:** Spain

**Alert submitted by:** Spain



**Alert number:** A12/0539/18

**Product:** Hairdryer

**Name:** Unknown

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Esperansa

**Type / number of model:** ES-1100-CC

**Risk level:** Serious risk

The rated current of the plug is not sufficient.

The current drawn by the hairdryer could damage the plug causing live parts to become accessible.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.


**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Electric hair dryer. Packaging: cardboard box.

**Batch number / Barcode:** 4895139206463

**Country of origin:** China

**Alert submitted by:** Poland

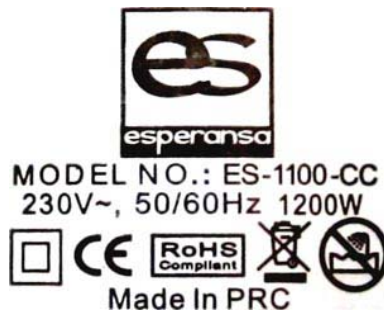

**Alert number:** A12/0545/18  
**Product:** Travel plug adaptor set  
**Name:** Universal Adapter  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** Travelon  
**Type / number of model:** Type: 19508  
**Risk level:** Serious risk  
 Live pins may be accessible during use.  
 The user could touch the live pins and receive an electric shock.

The product does not comply with the relevant national standard.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Travel plug adaptor set, packaged in clear plastic pack with cardboard backing

**Batch number / Barcode:** 025732 044757

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Ireland



**Alert number:** A12/0546/18  
**Product:** Power supply  
**Name:** Notebook Power Adapter  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** Extradigital  
**Type / number of model:** DE90G7450  
**Risk level:** Serious risk  
 The plastic housing is not heat resistant.  
 The plastic housing could deform leaving live parts accessible to the user.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

**Measures ordered by public authorities (to: Importer):** Ban on the marketing of the product and any accompanying measures

**Description:** Power supply for use with a notebook. Supplied in a cardboard box.

**Batch number / Barcode:** 6951758370218

**Country of origin:** China

**Alert submitted by:** Lithuania



**Alert number:** A12/0547/18

**Product:** UV nail lamp

**Name:** UV Lámpa

**Risk type:** Electric shock, Fire

**Category:** Electrical appliances and equipment

**Brand:** NABA / FEI MEI

**Type / number of model:** Type: SM/FMD-909, Ref.: NA661001; 909

**Risk level:** Serious risk

The PVC insulated wiring may overheat and the plastic casing is not resistant to heat. Accessible metal parts are separated with only basic insulation from live parts.

The plastic casing could melt catch fire. The user could receive an electric shock from accessible metal parts.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.


**Measures ordered by public authorities (to: Importer):** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Mains operated, UV nail dryer. Packaging: cardboard box.

**Batch number / Barcode:** 5 998603 363330

**Country of origin:** China

**Alert submitted by:** Hungary

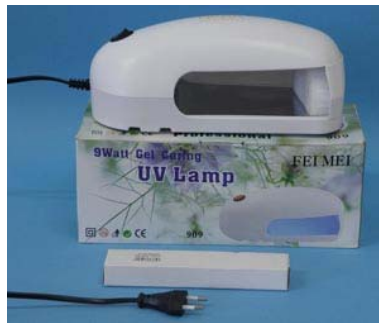

**Alert number:** A12/0531/18

**Product:** Bicycle

**Name:** Rockrider

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** B'TWIN

**Type / number of model:** 520, size M, colour: black, ref. no.: 1864811, 520, size M, colour: dark blue, ref. no.: 2002104, 540, size M, colour: grey, ref. no.: 1864082, 540, size XL, colour: grey, ref. no.: 1864085

**Risk level:** Serious risk

There may be a defect with the frame.

The frame could break causing the user to fall.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Mountain bike

**Batch number / Barcode:** Bicycles sold between 07.07.2017 and 18.12.2017

**Country of origin:** Portugal

**Alert submitted by:** Poland



**Alert number:** A12/0526/18  
**Product:** LED floodlight  
**Name:** Rechargeable floodlight  
**Risk type:** Electric shock  
**Category:** Lighting equipment  
**Brand:** V-TAC  
**Type / number of model:** Light: VT-4822. Power supply: S005ANV0500100  
**Risk level:** Serious risk  
 The electrical insulation of the power supply is insufficient.  
 The user could receive an electric shock from accessible parts.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities (to: Distributor):** Recall of the product from end users  
**Description:** LED rechargeable floodlight supplied with a power supply. Sold in a cardboard box.  
**Batch number / Barcode:** 3800157603515  
**Country of origin:** Bulgaria  
**Alert submitted by:** Finland



**Alert number:** A12/0534/18  
**Product:** LED floodlight  
**Name:** PIR LED Flood Light  
**Risk type:** Electric shock  
**Category:** Lighting equipment  
**Brand:** Unknown  
**Type / number of model:** R1658 (TD 5581)  
**Risk level:** Serious risk  
 The external wires are PVC-insulated.  
 Due to the aging of the PVC insulation in the open air, live parts may become accessible

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities (to: Retailer):** Recall of the product from end users, Withdrawal of the product from the market  
**Description:** Black LED floodlight with 30 LEDs and an adjustable motion sensor. The product is intended for outdoor use. Packaging: cardboard box.  
**Batch number / Barcode:** Unknown  
**Country of origin:** Unknown  
**Alert submitted by:** Hungary



**Alert number:** A12/0535/18  
**Product:** LED floodlight  
**Name:** Spotlights  
**Risk type:** Electric shock  
**Category:** Lighting equipment  
**Brand:** Unknown  
**Type / number of model:** R1704

**Risk level:** Serious risk

The external wires are PVC-insulated.

Due to the aging of the PVC insulation in the open air, live parts may become accessible

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities (to: Retailer):** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Black LED floodlight with 20 LEDs and an adjustable motion sensor. The product is intended for outdoor use. Packaging: cardboard box.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Hungary



**Alert number:** A12/0538/18

**Product:** Vehicle lift

**Name:** Unknown

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Krömer

**Type / number of model:** TP 16-3.2T-H

**Risk level:** Serious risk

The locking device on the arms can break under load.

The vehicle could fall from the lift crushing the operator.

The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1493.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Manufacturer)

**Description:** Two-post hydraulic vehicle lift

**Batch number / Barcode:** Unknown

**Country of origin:** Germany

**Alert submitted by:** France





**Alert number:** A12/0513/18  
**Product:** Wheel loaders  
**Name:** AX 700, AX 850, AX 1000  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mecalac  
**Type / number of model:** Approval number: ABE N050 Type: E213  
**Risk level:** Serious risk  
The fuel line can wear through and, with the passage of time, start to leak.  
There is the risk that fuel can leak out and ignite on contact with hot parts of the engine or end up on the road.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Wheel loaders  
**Batch number / Barcode:** The vehicles affected were manufactured between May 2015 and May 2017.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0514/18  
**Product:** Bus  
**Name:** Citraro  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Evobus  
**Type / number of model:** Type approval numbers: e1\*2007/46\*0087, e1\*2007/46\*0090 Types: 628 02, 628 03  
**Risk level:** Serious risk  
There is faulty bonding of the hinged window in the side window.  
The hinged window can come loose and fall onto the road.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Company recall page:**  
<http://keine Angabe> (<http://keine Angabe>)  
**Description:** Bus  
**Batch number / Barcode:** The vehicles affected were manufactured between October 2017 and November 2017.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0515/18  
**Product:** Goods transport vehicle  
**Name:** Multicar M 31  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Hako  
**Type / number of model:** Type-approval number: e1\*2007/46\*1136\*06  
**Risk level:** Serious risk  
The green sun strip on the windscreen filters red light.  
Traffic light signals are not always recognisable.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Goods transport vehicle  
**Batch number / Barcode:** The vehicles concerned were produced between July 2017 and December 2017.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0516/18  
**Product:** Van  
**Name:** TGE  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** MAN  
**Type / number of model:** Type-approval numbers: e1\*2007/46\*1626\*01 and e1\*2007/46\*1626\*02; Type: SYN1E  
**Risk level:** Serious risk  
With intensive trailer use, screws attaching the trailer coupling device may become loose.  
This may impair stability in trailer operation and ultimately lead to the entire trailer coupling device becoming detached.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Van  
**Batch number / Barcode:** The vehicles affected were produced between March 2017 and August 2017.  
**Country of origin:** Poland  
**Alert submitted by:** Germany

**Alert number:** A12/0519/18

**Product:** Van

**Name:** Master

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type / number of model:** Type MA e2\*2007/46\*0016\*28 to e2\*2007/46\*0016\*31 Type MB e2\*2007/46\*0019\*24 to ee\*2007/46\*0019\*27 Type MC e2\*2007/46\*0017\*16 à e2\*2007/46\*0017\*20 Type ME e2\*2007/46\*0018\*15 à e2\*2007/46\*0018\*17, Type ML e2\*2007/46\*0022\*20 to e2\*2007/46\*0022\*22 Type VA e2\*2007\*46\*0047\*22 to e2\*2007/46\*0047\*25 Type VB e2\*2007/46\*0049\*25 à e2\*2007/46\*0049\*28 Type VC e2\*2007/46\*0048\*12 à e2\*2007/46\*0048\*1, Type VE e2\*2207/46\*0021\*12 to e2\*2007/46\*0021\*14 Type VL e2\*2007/46\*0152\*14 to e2\*2007/46\*0152\*16

**Risk level:** Serious risk

The steering column cap may not be correctly tightened.

This could lead to a loss of vehicle steering.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Van

**Batch number / Barcode:** Vehicles manufactured between 12/5/2016 and 26/6/2017.

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Germany, Poland, The Netherlands

**Alert number:** A12/0520/18

**Product:** Passenger car

**Name:** Captur, Clio

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type / number of model:** e2\*2001/116\*0327\*77 to e2\*2001/116\*0327\*84 e2\*2007/46\*0008\*35 to e2\*2007/46\*0008\*38 e2\*2001/116\*0327\*80 to e2\*2001/116\*0327\*84

**Risk level:** Serious risk

The dipped headlamp beams may face downwards as a result of the the headlamp beam height correction system not working.

This would lead to reduced visibility for the driver at night.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Vehicles produced from the start of production until 23/10/2017.

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/0521/18

**Product:** Passenger car

**Name:** Captur, Clio, Zoé

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type / number of model:** e2\*2001/116\*0327\*83 et e2\*2007/46\*0251\*10

**Risk level:** Serious risk

Cracks may form in the front wheel hub.

The front wheel hub could consequently break leading to the front wheel become detached.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Vehicles manufactured between 22 September 2017 and 25 September 2017.

**Country of origin:** France, Slovenia, Spain

**Alert submitted by:** France

**Products were found and measures were taken also in:** Germany, The Netherlands

**Alert number:** A12/0528/18  
**Product:** Passenger car  
**Name:** Logan, Sandero  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Dacia  
**Type / number of model:** EC-type approval numbers: e2\*2001/116\*0314\*83, e2\*2007/46\*0030\*40.  
**Risk level:** Serious risk  
 Cracks may form in the front wheel hub.  
 The front wheel hub could consequently break leading to the front wheel become detached.  
**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)  
**Description:** Passenger car  
**Batch number / Barcode:** Manufactured from 22/09/2017 to 25/09/2017.  
**Country of origin:** Romania  
**Alert submitted by:** Portugal  
**Products were found and measures were taken also in:** Germany, Ireland

**Alert number:** A12/0529/18  
**Product:** Passenger car  
**Name:** Micra  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Nissan  
**Type / number of model:** K14; EC-type approval number: e9\*2007/46\*6454  
**Risk level:** Serious risk  
 Cracks may form in the front wheel hub.  
 The front wheel hub could consequently break leading to the front wheel become detached.  
**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)  
**Description:** Passenger car  
**Batch number / Barcode:** Production dates: 26/09/2017 to 04/10/2017.  
**Country of origin:** France  
**Alert submitted by:** Portugal  
**Products were found and measures were taken also in:** Germany, Poland, Slovakia

**Alert number:** A12/0530/18  
**Product:** Passenger car  
**Name:** Micra  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Nissan  
**Type / number of model:** K14; EC-type approval number: e9\*2007/46\*6454  
**Risk level:** Serious risk  
 The seat belt retractor internal car sensor may not function as intended.  
 In the event of an accident, the retractors could fail to lock and in such circumstances the seatbelt would not restrain the occupant.  
**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)  
**Description:** Passenger car  
**Batch number / Barcode:** Production dates: 26/09/2017 to 03/10/2017  
**Country of origin:** France  
**Alert submitted by:** Portugal  
**Products were found and measures were taken also in:** Germany, Poland, Slovakia, The Netherlands

**Alert number:** A12/0536/18  
**Product:** Passenger car  
**Name:** E-Pace  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Jaguar  
**Type / number of model:** Type approval number: E11\*2007/46\*4161.  
**Risk level:** Serious risk  
 The reversing lamps may fail.  
 This would mean that other road users would not be warned when the vehicle is reversing, which could lead to an accident.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Passenger car  
**Batch number / Barcode:** Vehicles built between 27/07/2017 and 02/03/2018. Vehicles fitted with manual transmission only.  
**Country of origin:** United Kingdom  
**Alert submitted by:** United Kingdom

**Alert number:** A12/0549/18

**Product:** Scooter grip

**Name:** Grip soft super bike

**Risk type:** Chemical

**Category:** Motor vehicles

**Brand:** Scooped

**Type / number of model:** Grip soft, super bike

**Risk level:** Serious risk

The plastic material of the product contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 11.2% by weight) and diisobutyl phthalate (DIBP) (26.2 % by weight).

These phthalates are toxic to reproduction.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** A pair of black motor-scooter handles attached to black cardboard

**Batch number / Barcode:** 5705755163523

**Country of origin:** India

**Alert submitted by:** Denmark



**Alert number:** A12/0552/18

**Product:** Buses and coaches

**Name:** Evobus

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citaro, Setra

**Type / number of model:** Type-approval number: e1\*2007/46\*0087, e1\*2007/46\*0090, e1\*2007/46\*0089, e1\*2007/46/\*0097 Type: 628 02, 628 03, 628 04, 628 21, Sales description: Citaro, Setra

**Risk level:** Serious risk

A problem with the door control unit could lead to the anti-trap device for the doors failing.

This could lead to passengers being caught in the closing doors.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Buses and coaches

**Batch number / Barcode:** The vehicles concerned were manufactured between 1998 and 2010.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0522/18  
**Product:** Whipping siphon  
**Name:** Unknown  
**Risk type:** Injuries  
**Category:** Pressure equipment/vessels  
**Brand:** JJA

**Type / number of model:** 136010

**Risk level:** Serious risk

The pressure-relief valve on the head of the whipping siphon is defective.  
 The valve could be ejected from the siphon causing injuries to the user.

The product does not comply with the requirements of the Pressure Equipment Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Culinary whipping siphon with a capacity of 500 ml, for making whipped cream, for example.

**Batch number / Barcode:** 3560238905227/ M08698 and M09042, 3560238905234/ M08698 and M09042, 3560239259503 / M08698 and M09042, 3560239259510/ M08698

**Country of origin:** Hong Kong

**Alert submitted by:** France



**Alert number:** A12/0524/18

**Product:** Children's play helmet

**Name:** Unknown

**Risk type:** Injuries

**Category:** Protective equipment

**Brand:** Jofa

**Type / number of model:** Play helmet 215

**Risk level:** Serious risk

The shock-absorbing capacity is not sufficient.

Consequently, the helmet does not provide sufficient protection in case of an impact and the user might suffer from head injuries.

The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN 1080.

**Measures ordered by public authorities (to: Distributor):** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Helmet for young children for play activities.

**Batch number / Barcode:** Manufactured 01/2011 or later

**Country of origin:** Unknown

**Alert submitted by:** Finland



**Alert number:** A12/0517/18

**Product:** Plastic toys

**Name:** Children's Toy

**Risk type:** Chemical, Choking, Suffocation

**Category:** Toys

**Brand:** Ha Ha Xiong

**Type / number of model:** Unknown

**Risk level:** Serious risk

The product contains diisobutyl phthalate (DIBP) (measured value 18.7% by weight) and small parts can easily be detached from the toy.

This phthalate is toxic to reproduction. Small children may put the small parts in the mouth and choke.

Moreover, the plastic of the packaging is too thin: If a child plays with it, the plastic might cover the nose and mouth, causing the child to suffocate.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Plastic animal-shaped toys which make noises when squeezed.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0518/18

**Product:** Fidget spinner

**Name:** LED Finger Twister

**Risk type:** Chemical

**Category:** Toys

**Brand:** gutoy's

**Type / number of model:** Art.No. 6286

**Risk level:** Serious risk

The battery compartment can easily be opened without use of any tools and the button cell batteries inside are easily accessible.

Children might put them in the mouth and swallow them, causing damage to their gastrointestinal tract.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

**Measures taken by economic operators:** Temporary ban on the supply, offer to supply and display of the product (By: Retailer)

**Measures ordered by public authorities:** Temporary ban on the supply, offer to supply and display of the product

**Description:** Fidget spinner with 3 LED lights in cardboard packaging with transparent window.

**Batch number / Barcode:** 4013840062868

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0525/18

**Product:** Expandable toy

**Name:** Growing Pet Hatch'Em

**Risk type:** Choking, Injuries

**Category:** Toys

**Brand:** Robetoy

**Type / number of model:** Unknown

**Risk level:** Serious risk

Small parts can be easily torn from the toy dinosaur and may be put into the mouth and swallowed by children.

This could cause the child to choke. As the toy expands, it can also cause fatal occlusion of the respiratory track or intestinal blockage of children.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Retailer)

**Description:** Plastic eggs containing small plastic dinosaurs. The eggs are placed in water and after some time the dinosaurs break out of the egg, having increased in size. Packaging: cardboard box with window

**Batch number / Barcode:** 7300009491049

**Country of origin:** China

**Alert submitted by:** Denmark





**Alert number:** A12/0527/18

**Product:** Plastic doll set

**Name:** Sunshine girl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** DAH797517; NO.231

**Risk level:** Serious risk

The doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 27.6 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Set of two plastic dolls. Cardboard packaging with transparent window.

**Batch number / Barcode:** 6991207975175

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0532/18

**Product:** Toy robot

**Name:** Dance King

**Risk type:** Damage to hearing

**Category:** Toys

**Brand:** Year O Toy

**Type / number of model:** Item No. 110006A

**Risk level:** Serious risk

The sound level is too high.

If used over a long period of time, the toy could cause damage to hearing.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities (to: Distributor):** Withdrawal of the product from the market

**Description:** Dancing and rotating toy robot that emits music and light during use. Packaging: cardboard box.

**Batch number / Barcode:** 8032014006008

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0537/18

**Product:** Baby toy

**Name:** Monkey Keys

**Risk type:** Choking, Injuries

**Category:** Toys

**Brand:** Kidz Delight

**Type / number of model:** K16560/S16560 S16560-30022

**Risk level:** Serious risk

The screw for the cover of the battery compartment is too short. As a result, the cover could fall off, leaving the button cell batteries accessible. A young child could put the button cell batteries in the mouth. This could lead to the child choking or, if the button cell batteries were swallowed, damage to the gastrointestinal tract.

The product does not comply with the requirements of the Toys Directive and the relevant European standard EN 62115.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** A blue plastic toy monkey with orange ears.

**Batch number / Barcode:** 8136538671986, Batch no 02-160718

**Country of origin:** China

**Alert submitted by:** Sweden

**Products were found and measures were taken also in:** Denmark



**Alert number:** A12/0540/18

**Product:** Plastic doll

**Name:** Sweet

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** LG6272

**Risk level:** Serious risk

The plastic material of the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 33.6 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Plastic doll (Sweet / FASHION STYLE) about 15 cm tall with red shoes and with long pink hair pulled back in a ponytail.

**Batch number / Barcode:** 8001002103104

**Country of origin:** China

**Alert submitted by:** Czech Republic



**Alert number:** A12/0542/18

**Product:** Toy kick scooter

**Name:** Hulajnoga krokodyl

**Risk type:** Injuries

**Category:** Toys

**Brand:** Mrowiec Toys

**Type / number of model:** Unknown

**Risk level:** Serious risk

The handlebar of the kick scooter may break, leaving sharp edges accessible.

A child riding the scooter might lose balance and fall to the ground or fall on the sharp edges of the broken handlebar, leading to injuries.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Manufacturer)

**Description:** Crocodile-shaped plastic kick scooter, for children weighing less than 20 kg. Packaged in plastic bag.

**Batch number / Barcode:** 5908258103656, Placed on the market between 13.10.2017 and 17.02.2018.

**Country of origin:** Poland

**Alert submitted by:** Poland



**Alert number:** A12/0543/18

**Product:** Plastic doll

**Name:** Маша и Медведь

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** NO. MS-6

**Risk level:** Serious risk

The plastic material of the product contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 16% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Plastic doll "Masha and the Bear" (written in Cyrillic on the packaging), with a red dress and headscarf, about 25cm tall.

**Batch number / Barcode:** 4-576-24.8, 8594576259549 , ITEM NO: TB-2755

**Country of origin:** China

**Alert submitted by:** Czech Republic



**Alert number:** A12/0544/18

**Product:** Plastic doll

**Name:** Fashion

**Risk type:** Chemical, Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** art#8099A; NO.8099

**Risk level:** Serious risk

The battery compartment can easily be opened without use of any tools and the button cell batteries inside are accessible.  
A child might put them in the mouth and swallow them, causing choking or damage to the gastrointestinal tract

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Plastic, sound-emitting doll, powered with button batteries. Packaged in a cardboard packaging with plastic window.

**Batch number / Barcode:** 5901002003479

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0548/18

**Product:** Toy with sweets

**Name:** Unknown

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Risk level:** Serious risk

A sticker with a plastic film can detach easily from the toy generating small parts.

A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


**Measures ordered by public authorities (to: Distributor):** Withdrawal of the product from the market

**Description:** A wind-up excavator toy made of hard yellow plastic with 4 red wheels, attached to a tube containing a plastic bag of sweets with stickers of cars.

**Batch number / Barcode:** 8681161440656

**Country of origin:** China

**Alert submitted by:** Lithuania

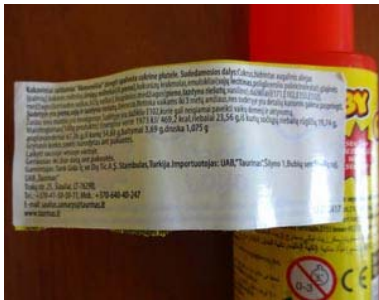



**Alert number:** A12/0551/18

**Product:** Bath toy

**Name:** Swimming

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Art. No. 011

**Risk level:** Serious risk

A small part (wind-up mechanism) can easily be detached from the toy.

A small child may put this small part in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

**Measures ordered by public authorities (to: Importer):** Ban on the marketing of the product and any accompanying measures

**Description:** A blue wind-up frog made of hard plastic with silver spots on the back.

**Batch number / Barcode:** 4812501138139

**Country of origin:** China

**Alert submitted by:** Lithuania



**Alert number:** A11/0029/18

**Product:** Electric heater

**Name:** Quartz Heater

**Risk type:** Burns, Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Onex

**Type / number of model:** QH-80C

**Risk level:** Other risk level

The electrical insulation is inappropriate. The product overheats.

Live parts can become accessible. The user can receive burns from hot surfaces.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities (to: Importer):** Ban on the marketing of the product and any accompanying measures

**Description:** Electric heater for indoor use, 800W, packed in a green cardboard box.

**Batch number / Barcode:** 0000011498179

**Country of origin:** China

**Alert submitted by:** Lithuania



**Alert number:** A11/0028/18

**Product:** Vehicle lift

**Name:** Unknown

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Prestige Lift

**Type / number of model:** AA-2PCF 50

**Risk level:** Other risk level

The teeth of the locking device can break under load.

The vehicle could fall from the lift crushing the operator.

The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1493.

**Measures ordered by public authorities (to: Importer):** Ban on the marketing of the product and any accompanying measures

**Description:** Two-post vehicle lift

**Batch number / Barcode:** Year of manufacture 2013

**Country of origin:** Spain

**Alert submitted by:** France

