



The Rapid Alert System for Non-Food Products (RAPEX)

- Weekly overview report of RAPEX notifications**week 44 - 2014**



| Level | Type | No. Ref. | Notifying country | Product | Risk | Measures adopted by notifying country | Products were found and measures were taken also in: |
|--------------|-------------------|------------------|-------------------|---|---|--|--|
| Serious risk | Consumer products | 1 A12/1738/14 | Hungary | <p>Category: Lighting equipment</p> <p>Product: Light bulb</p> <p>Brand: Raoium</p> <p>Name: Unknown</p> <p>Type/number of model: C7 E12</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: Incandescent light bulb with E12 cap. Packaging: blue cardboard box.</p> <p>Country of origin: China</p>  | <p>Electric shock</p> <p>The light bulb has an E12 cap. Live parts become accessible when the light bulb is used in a different sized lamp holder.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60432.</p> | <p>Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users</p> | |
| Serious risk | Consumer products | 2 A12/1740/14 | Finland | <p>Category: Communication and media equipment</p> <p>Product: MP3 player with battery charger</p> <p>Brand: König</p> <p>Name: Cassette shaped MP3 player</p> | <p>Electric shock</p> <p>The insulation of the battery charger supplied with the MP3 professional music player is not sufficient,</p> | <p>Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users</p> | |


| | | | | | | | |
|--------------|-------------------|------------------|--------|--|--|---|--------------------------|
| | | | | <p>Type/number of model: Battery charger n°: LD-005</p> <p>Batch number/Barcode: 5412810111749</p> <p>OECD Portal Category: 68000000 - Audio Visual / Photography</p> <p>Description: Cassette shaped MP3 player supplied with a battery charger. Sold in a white transparent package. Electrical specifications: Input:100-240 VAC, 50/60 Hz Output: DC 5V, 500mA</p> <p>Country of origin: China</p>  | <p>furthermore the creepage distance between the primary and secondary winding is not sufficient. A person can touch part of the product that is at live due to the defects, receive an electric shock and be electrocuted.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60065 and EN 50075.</p> | | |
| Serious risk | Consumer products | 3 A12/1741/14 | Greece | <p>Category: Motor vehicles</p> <p>Product: Passenger car</p> <p>Brand: Skoda</p> <p>Name: Fabia and Roomster</p> <p>Type/number of model: Fabia II and Roomster</p> <p>Batch number/Barcode: Model year 2011 to 2015 vehicles with 1.2l / 55 kW common rail engine.</p> <p>OECD Portal Category: 77000000 -</p> | <p>Injuries</p> <p>Vibration can be transmitted to the fuel filter cover because of the pressure pulsations in the fuel lines. This can crack the filter cover in the area of the supply neck and result in fuel leaks. This could cause an accident of the vehicle or of a following one.</p> | Voluntary measures: Recall of the product from end users | The Netherlands, Germany |

| | | | | | | | |
|--------------|-------------------|------------------|----------------|---|---|--|--------------------|
| | | | | <p>Automotive</p> <p>Description: Passenger car.</p> <p>Country of origin: Czech Republic</p> <p>No pictures are available</p> | | | |
| Serious risk | Consumer products | 4 A12/1742/14 | Greece | <p>Category: Motor vehicles</p> <p>Product: Passenger car</p> <p>Brand: Nissan</p> <p>Name: Micra and Patrol</p> <p>Type/number of model: Micra (K13), Patrol (Y62 NML) and Patrol (Y62 NMGR)</p> <p>Batch number/Barcode: Vehicles, produced: K13: from 27/05/2010 to 31/07/2012, Y62 NML: from 11/05/2010 to 10/02/2014 and Y62 NMGR: from 04/09/2012 to 18/04/2014, with Type Approval No.: K13: e13*2007/46*1111*00 and Y62 (NML and NMGR): E-CH.MT02.B.00752.P1</p> <p>OECD Portal Category: 77000000 - Automotive</p> <p>Description: Passenger car.</p> <p>Country of origin: India</p> <p>No pictures are available</p> | <p>Injuries</p> <p>The driver airbag inflator may have been assembled incorrectly. In the event of deployment of the airbag, the gas flow path may be blocked increasing the internal pressure in the inflator. As a result, the driver airbag inflator casing may crack and fragment causing injuries.</p> | <p>Voluntary measures: Recall of the product from end users</p> | Portugal, Slovakia |
| Serious risk | Consumer products | 5 A12/1743/14 | Czech Republic | <p>Category: Toys</p> <p>Product: Charms for loom bands</p> <p>Brand: Unknown</p> <p>Name: Colourful Accessories - Endless Flexible</p> <p>Type/number of model: Unknown</p> <p>Batch</p> | <p>Chemical</p> <p>The charms contain bis(2-ethylhexyl) phthalate (DEHP) above the permitted level (measured value: 6.8% by weight). This phthalate may harm the</p> | <p>Compulsory measures: Withdrawal of the product from the market</p> | |

| | | | | | | |
|--------------|-------------------|------------------|---------|--|---|--|
| | | | | <p>number/Barcode: EAN: 3905000009701</p> <p>OECD Portal Category: 86000000 - Toys / Games</p> <p>Description: 18 pieces of colourful loom band charms in soft plastic, different shapes and colours (hearts, flowers, butterflies, stars etc.).</p> <p>Country of origin: China</p>  | <p>health of children, causing possible damage of the reproductive system.</p> <p>According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.</p> | |
| Serious risk | Consumer products | 6 A12/1745/14 | Finland | <p>Category: Communication and media equipment</p> <p>Product: External hard drive with power supply</p> <p>Brand: König</p> <p>Name: USB2.0 to IDE/S-ATA adapter</p> <p>Type/number of model: Model n°: 34W-5-12</p> <p>Batch number/Barcode: 5412810111749</p> <p>OECD Portal Category: 65000000 - Computing</p> <p>Description: External hard drive supplied with a power supply unit. Sold in a white cardboard box. Electrical specifications: 100-240 VAC, 50/60 Hz, 0.5 A, Class I. Output: 12 V d.c., 2 A; 5 V d.c., 2 A.</p> <p>Country of origin: China</p> | <p>Electric shock</p> <p>The insulation of the power supply unit is not sufficient, furthermore the clearance /creepage distances between the primary and secondary circuits are not sufficient. A person can touch part of the product that is at live due to the defects, receive an electric shock and be electrocuted.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.</p> | <p>Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users</p> |



| | | | | | | |
|--------------|-------------------|------------------|---------|--|----------|--|
| | | | | | | |
| Serious risk | Consumer products | 7 A12/1746/14 | Latvia | <p>Category: Toys</p> <p>Product: Plastic doll</p> <p>Brand: Gong Sheng Toys</p> <p>Name: Hello Baby</p> <p>Type/number of model: No.391, Art No.: 62310002</p> <p>Batch number/Barcode: 4752067048780</p> <p>OECD Portal Category: 86000000 - Toys / Games</p> <p>Description: Plastic man doll in a red suit. The product is supplied in a transparent plastic bag with a cardboard tag on the top.</p> <p>Country of origin: China</p> | Chemical | Voluntary measures: Destruction of the product |
| | | | |   | | |
| Serious risk | Consumer products | 8 | Finland | <p>Category: Toys</p> | Choking | Compulsory |

| | | | | | | |
|--------------|-------------------|------------------|--------|--|---|---|
| | | A12/1747/14 | | <p>Product: Plush toy</p> <p>Brand: Spen</p> <p>Name: Souvenirs From Finland</p> <p>Type/number of model: Article number: 9167/J03-2</p> <p>Batch number/Barcode: 6426600091677</p> <p>OECD Portal Category: 86000000 - Toys / Games</p> <p>Description: A reindeer plush toy made of grey and white fake fur. The hooves are dark brown. The reindeer has plastic eyes and a white beard. The legs have a metal wire inside of them.</p> <p>Country of origin: China</p>  | <p>The small plastic eyes can easily come off. If small children put them in the mouth, they may obstruct the airways. In addition, the metal wire inside the legs can easily break: this may lead to accessible sharp metal edges which could cause injuries.</p> <p>The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</p> | <p>measures: Import rejected at border</p> |
| Serious risk | Consumer products | 9 A12/1748/14 | France | <p>Category: Electrical appliances and equipment</p> <p>Product: USB power supply</p> <p>Brand: Casa</p> <p>Name: Unknown</p> <p>Type/number of model: Casa: 460411 (Jays model SD-0505006)</p> <p>Batch number/Barcode: 2000004604110</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: Black plastic adapter with mains plug (entry) and USB port (exit). Blister pack.</p> <p>Country of origin:</p> | <p>Electric shock</p> <p>The electrical insulation is not adequate.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61558.</p> | <p>Voluntary measures: Withdrawal of the product from the market, Recall of the product from end users</p> |

China



Serious risk

Consumer products

10
A12/1749/14

Slovakia

Category: Lighting equipment

Product: Night light

Brand: Horoz Electric

Name: Energy Saving Fluorescent Night Light


Type/number of model: HL 985

Batch number/Barcode: 5901477322549

OECD Portal Category: 78000000 - Electrical Supplies

Description: Night light with a yellow plastic base, with an integrated mains plug and power switch. Packed in a transparent plastic blister with cardboard backing.

Country of origin: China

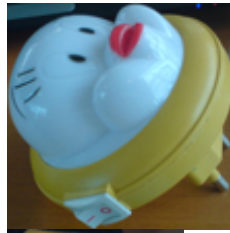

Electric shock

The material of the lamp is not resistant to heat and may deform. As a result, the user may have direct access to live parts.


The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61598.

Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users




| | | | | | | | |
|--------------|-------------------|-------------------|----------|--|---|---|--|
| Serious risk | Consumer products | 11 A12/1750/14 | Germany | <p>Category: Toys</p> <p>Product: Plastic toy duck</p> <p>Brand: KIG</p> <p>Name: Yo Yo Duck</p> <p>Type/number of model: Article No 330/0700</p> <p>Batch number/Barcode: Lot: 10187, 4250052672335</p> <p>OECD Portal Category: 86000000 - Toys / Games</p> <p>Description: Toy duck made of soft plastic, containing a ball with motion-activated light. An elastic cord with a rubber ring is attached to the duck. The product is supplied without packaging, a label is attached.</p> <p>Country of origin: China</p> | <p>Choking</p> <p>The plastic of the duck can easily tear off leaving the small flashing ball accessible. If put in the mouth by small children, it may cause choking.</p> <p>The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</p> | <p>Voluntary measures: Withdrawal of the product from the market</p> <p>Compulsory measures: Recall of the product from end users</p> | |
| Serious risk | Consumer products | 12 A12/1751/14 | Slovakia | <p>Category: Lighting equipment</p> <p>Product: Night light</p> | <p>Electric shock</p> <p>The cover can be easily</p> | <p>Compulsory measures: Withdrawal of the product</p> | |

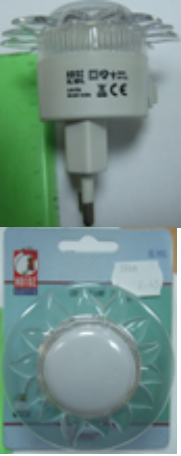

| | | | | | | |
|--------------|-------------------|-------------------|---------|---|--|---|
| | | | | <p>Brand: Horoz Electric</p> <p>Name: LED Night Lamp</p> <p>Type/number of model: HL 991L</p> <p>Batch number/Barcode: 5901477322617</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: Night light with a white plastic base, with an integrated mains plug and power switch. Packed in a transparent plastic blister with cardboard backing.</p> <p>Country of origin: China</p>  | <p>separated from the base. The material of the lamp is not resistant to heat and may deform. As a result of both defects, the user may have direct access to live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61598.</p> | <p>from the market, Recall of the product from end users, Ban on the marketing of the product and any accompanying measures</p> |
| Serious risk | Consumer products | 13 A12/1752/14 | Finland | <p>Category: Decorative articles</p> <p>Product: Decorative fireplace</p> <p>Brand: Mastermark</p> <p>Name: Tabletop fireplace</p> <p>Type/number of model: Article n°: T27582A4X/WY840B-20</p> <p>Batch number/Barcode: 6430023003681</p> <p>OECD Portal Category: 75000000 - Household / Office Furniture / Furnishings</p> <p>Description: The tabletop fire consists</p> | <p>Burns, Fire</p> <p>The table fire has an unsafe structure: the fuel tank leaks from its upper junction when it is filled full. The leaked fuel may get into the space with stones, in which case the decorative stones made difficult to extinguish the fire. That may lead to a situation where flames can cause burns and fire.</p> | <p>Compulsory measures: Import rejected at border</p> |


of a black iron base and clear cover glass. The bioethanol tank is made of stainless steel and is placed in the middle of iron base. This tabletop fire includes white decorative stones and an extinguisher. White decorative stones are adjusted on the iron base round fuel tank. Cover glass is 17 cm long and base is 10 cm.


Country of origin:
China

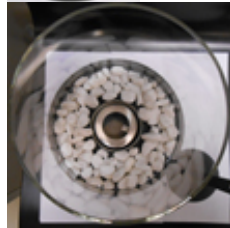


| | | | | | | | |
|---------------------|--------------------------|---------------------------|---------------|--|--|--|--|
| <p>Serious risk</p> | <p>Consumer products</p> | <p>14 A12/1753/14</p> | <p>Poland</p> | <p>Category: Motor vehicles Product: Passenger car Brand: Mitsubishi Name: Outlander Type/number of model: GF6W, GF7W Batch number/Barcode: Model year: 2014 OECD Portal Category: 77000000 - Automotive Description: Passenger car with tow bar (mechanical coupling device) as original equipment. Country of origin: Japan</p> | <p>Injuries For cars not equipped with ACC/FCM (Active Cruise Control / Forward Collision Mitigation system), the HMSL (High Mounted Stop Light) might permanently glow slightly when the lights are on. This potentially may lead to a road accident. For cars equipped with ACC/FCM, on the other hand, there is a risk that a malfunction in the stop light</p> | <p>Voluntary measures: Recall of the product from end users</p> | |
|---------------------|--------------------------|---------------------------|---------------|--|--|--|--|


| | | | | | | | |
|--------------|-------------------|-------------------|----------|---|---|--|--|
| | | | | No pictures are available | circuit will not be detected, causing a potential risk of incorrect functioning of the ASC system, which may lead to a road accident. | | |
| Serious risk | Consumer products | 15 A12/1754/14 | Portugal | <p>Category: Motor vehicles</p> <p>Product: Truck</p> <p>Brand: Mitsubishi Fuso</p> <p>Name: Canter</p> <p>Type/number of model: Canter TF/TF1 (FEA01, FEA51, FEB01, FEB71, FEB74, FEC71)</p> <p>Batch number/Barcode: Model Year: 2012 - 2014; production period: from 16th September 2011 to 18th December 2013.</p> <p>OECD Portal Category: 77000000 - Automotive</p> <p>Description: Truck</p> <p>Country of origin: Portugal</p> <p>No pictures are available</p> | <p>Injuries</p> <p>Gear changing maybe affected by contamination of the hydraulic system. In the worst case, the engine may stall or it may not be possible to change gear increasing the risk of a crash.</p> | Voluntary measures: Recall of the product from end users | |
| Serious risk | Consumer products | 16 A12/1755/14 | Finland | <p>Category: Lighting equipment</p> <p>Product: LED Lamp</p> <p>Brand: Zodiak</p> <p>Name: LED lamppu</p> <p>Type/number of model: SELB21-6</p> <p>Batch number/Barcode: 6438168079875</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: LED lamp. Sold in a white cardboard box.</p> | <p>Electric shock</p> <p>The insulation of the LED lamp is not sufficient and the creepage distance from the live parts to the accessible metal frame is not sufficient. A person can touch part of the product that is at live due to the defects and receive an electric shock and be electrocuted.</p> | Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users | |



| | | | | | | | |
|--------------|-------------------|-------------------|----------------|--|--|--|--|
| | | | | <p>Electrical specifications: DR - 6W - E27, 220-240V, 50/60 Hz, 60mA, 3000 K.</p> <p>Country of origin: China</p>  | <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.</p> | | |
| Serious risk | Consumer products | 17 A12/1756/14 | Greece | <p>Category: Motor vehicles</p> <p>Product: Passenger car</p> <p>Brand: Fiat</p> <p>Name: Fiat 500L</p> <p>Type/number of model: 500L all models with knee-bag</p> <p>Batch number/Barcode: The recall affects vehicles, whose chassis numbers range between 5000021 and 5176830.</p> <p>OECD Portal Category: 77000000 - Automotive</p> <p>Description: Passenger car.</p> <p>Country of origin: Italy</p> <p>No pictures are available</p> | <p>Injuries</p> <p>The knee airbag may not open correctly in case of an accident.</p> | <p>Voluntary measures: Recall of the product from end users</p> | |
| Serious risk | Consumer products | 18 A12/1757/14 | Czech Republic | <p>Category: Toys</p> <p>Product: Squeeze toy</p> <p>Brand: EXCLAIMED</p> | <p>Chemical</p> <p>The plastic material of the toy contains bis</p> | <p>Compulsory measures: Withdrawal of the product</p> | |

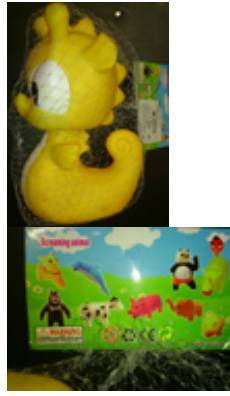

| | | | | | | |
|--------------|-------------------|-------------------|----------------|---|--|--|
| | | | | <p>TOY</p> <p>Name: Unknown</p> <p>Type/number of model: ITEM NO: TN40535</p> <p>Batch number/Barcode: EAN: 8418868405356</p> <p>OECD Portal Category: 86000000 - Toys / Games</p> <p>Description: Plastic squeeze toy in the form of a shark in blue colour with a white belly, 28 cm long. Packaging: white plastic net with paper label.</p> <p>Country of origin: China</p>  | <p>(2-ethylhexyl) phthalate (DEHP) above the permitted levels (measured value: 3.2% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.</p> <p>According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.</p> | <p>from the market</p> |
| Serious risk | Consumer products | 19 A12/1758/14 | Czech Republic | <p>Category: Toys</p> <p>Product: Squeeze toy</p> <p>Brand: Unknown</p> <p>Name: Screaming animal</p> <p>Type/number of model: ITEM NO:TN 40537</p> <p>Batch number/Barcode: EAN : 8418868405370</p> <p>OECD Portal Category: 86000000 - Toys / Games</p> <p>Description: Plastic yellow squeeze toy in the shape of a seahorse with white chest and black/white eyes, about 20 cm, packed in plastic net.</p> <p>Country of origin: China</p> | <p>Chemical</p> <p>The plastic material of the toy contains bis (2-ethylhexyl) phthalate (DEHP) above the permitted levels (measured value: 9.7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.</p> <p>According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.</p> | <p>Compulsory measures: Withdrawal of the product from the market</p> |



| | | | | | | | |
|--------------|-------------------|-------------------|----------------|--|--|--|--|
| Serious risk | Consumer products | 20 A12/1759/14 | Czech Republic | <p>Category: Cosmetics</p> <p>Product: Wet wipes</p> <p>Brand: Papilion</p> <p>Name: Wet towel</p> <p>Type/number of model: LOT NO: 20000 12:21 PR.D: 24/05/2014, EXP.D: 24/05/2014</p> <p>Batch number/Barcode: EAN: 8692857013153</p> <p>OECD Portal Category: 53000000 - Beauty / Personal Care / Hygiene</p> <p>Description: Wet wipes 72 pieces in a repeatedly self-sealing package. On the front of the product there are pictures of aloe vera. On the back of the packaging there is a picture of mother with infant, a description of how to use the product, ingredients, pictograms for use, graphic symbols, etc.</p> <p>Country of origin: Turkey</p> | <p>Chemical</p> <p>The product poses a chemical risk due to the presence of lodopropynyl butylcarbamate (IPBC), which is banned in products intended for children under 3 years of age. IPBC may penetrate the skin of the infant and may have an adverse effect on the function of thyroid gland.</p> <p>The product does not comply with the requirements of the Cosmetics Regulation.</p> | <p>Compulsory measures: Withdrawal of the product from the market</p> | |
| Serious risk | Consumer products | 21 A12/1760/14 | Germany | <p>Category: Electrical appliances and equipment</p> <p>Product: Mains extension lead</p> | <p>Electric shock</p> <p>The live and earth wires may be switched at the</p> | <p>Voluntary measures: Withdrawal of the product from the market,</p> | |

| | | | | | | |
|---------------------|--------------------------|---------------------------|-----------------------|--|---|--|
| | | | | <p>Brand: Bachmann</p> <p>Name: Smart Line 3x</p> <p>Type/number of model: H05VV-F 3G1, 5 mm², 5m; product ref. 387.172</p> <p>Batch number/Barcode: 4016514003853</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: Three-socket extension lead with 5m cable.</p> <p>Country of origin: Unknown</p>  | <p>socket. This may result in the user suffering an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.</p> | <p>Recall of the product from end users</p> |
| <p>Serious risk</p> | <p>Consumer products</p> | <p>22 A12/1761/14</p> | <p>United Kingdom</p> | <p>Category: Jewellery</p> <p>Product: Necklace</p> <p>Brand: Restyle.pl</p> <p>Name: Della Morte Bat Necklace</p> <p>Type/number of model: SPRDMORTE. Model: 30036</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 64000000 - Personal Accessories</p> <p>Description: Necklace linked chain with a bat shaped pendant attached. Product is supplied in a clear plastic sleeve with a small cardboard tag attached to the necklace with the word Restyle.pl in stylised text.</p> <p>Country of origin: Poland</p> | <p>Chemical</p> <p>The product is designed to be worn in contact with the skin. The product contains excessive amounts of cadmium (measured value: 41.6% by weight). Cadmium is classified as harmful if swallowed, if inhaled and if in contact with the skin.</p> <p>The product does not comply with the requirements of the REACH Regulation.</p> | <p>Voluntary measures: Recall of the product from end users</p> |

| | | | | | | | |
|--------------|-------------------|-------------------|----------------|--|----------|---|---|
| | | | |  | | | |
| Serious risk | Consumer products | 23 A12/1762/14 | United Kingdom | <p>Category: Jewellery</p> <p>Product: Choker necklace</p> <p>Brand: Restyle.pl</p> <p>Name: Gothic Raven Choker</p> <p>Type/number of model: SPRRAVENCH. Model: 30035</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 64000000 - Personal Accessories</p> <p>Description: Necklace with linked metal chain and raven shaped pendant. The product is supplied in a clear plastic sleeve with a small cardboard tag featuring the stylised word Restyle.pl.</p> <p>Country of origin: Poland</p>  | Chemical | <p>The product is designed to be worn against the skin of the neck. The product contains excessive amounts of cadmium (measured value: 87.1% by weight). Cadmium is classified as harmful if swallowed, if inhaled and if in contact with the skin.</p> <p>The product does not comply with the requirements of the REACH Regulation.</p> | Voluntary measures: Recall of the product from end users |
| Serious risk | Consumer products | 24 A12/1763/14 | Slovakia | <p>Category: Toys</p> <p>Product: Set of plastic dolls</p> <p>Brand: Unknown</p> <p>Name: Fashion doll</p> <p>Type/number of model: NO.228 (on the package) STC293316 (on the label)</p> <p>Batch number/Barcode: 6991202933163 (on the label)</p> <p>OECD Portal</p> | Chemical | <p>The dolls contain bis (2-ethylhexyl) phthalate (DEHP) (measured values up to 32.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.</p> | Compulsory measures: Ban on the marketing of the product and any accompanying measures, Withdrawal of the product from the market, Recall of the product from end users |

| | | | | | | | |
|--------------|-------------------|-------------------|-------|--|---|--|--|
| | | | | <p>Category: 86000000 - Toys / Games</p> <p>Description: Set of two plastic dolls, a man in a suit and a woman in a dress. Packed in a transparent plastic blister with a paper back.</p> <p>Country of origin: China</p>  | <p>According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.</p> | | |
| Serious risk | Consumer products | 25 A12/1764/14 | Spain | <p>Category: Lighting equipment</p> <p>Product: Outdoor lamp</p> <p>Brand: Happy Garden</p> <p>Name: Lanterna - per esterno</p> <p>Type/number of model: 507565</p> <p>Batch number/Barcode: 8015361323288</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: Outdoor luminaire, with protective grille, 60W, E27, 230V, 50Hz, IP54. It comes in a cardboard box bearing the wording "Lanterna per esterno. Happy Garden".</p> <p>Country of origin: China</p>  | <p>Electric shock</p> <p>A large amount of water can infiltrate the interior of the product thus accessing live parts. If touched, it could cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.</p> | <p>Compulsory measures: Withdrawal of the product from the market</p> | |



| | | | | | | | |
|---------------------|--------------------------|---------------------------|----------------|---|--|--|--|
| <p>Serious risk</p> | <p>Consumer products</p> | <p>26 A12/1765/14</p> | <p>Spain</p> | <p>Category: Electrical appliances and equipment</p> <p>Product: Power supply with USB ports</p> <p>Brand: König</p> <p>Name: High Performance USB Hub</p> <p>Type/number of model: CMP-USBHUB56 and CMP-USB2HUB50</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 78000000 - Electrical Supplies</p> <p>Description: Adapter/charger, with four or seven USB ports, intended for use with tablet computers. It is packed in a clear plastic blister pack.</p> <p>Country of origin: China</p> | <p>Fire</p> <p>The plastic housing of the product is not sufficiently resistant to catching fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61598.</p> | <p>Voluntary measures: Recall of the product from end users</p> | |
| <p>Serious risk</p> | <p>Consumer products</p> | <p>27 A12/1766/14</p> | <p>Hungary</p> | <p>Category: Clothing, textiles and fashion items</p> <p>Product: Children's sweatshirt</p> <p>Brand: H.Plenty</p> <p>Name: Unknown</p> | <p>Strangulation</p> <p>The drawstring with free ends placed in the hood may cause strangulation to children.</p> | <p>Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users</p> | |




Type/number of model: 1. Model: ZF8792,
2. Model: ZF8793

Batch number/Barcode:
Unknown

OECD Portal Category: 67000000 - Clothing

Description: Dark and light blue sweatshirt with hood, zip-fastener and kangaroo pockets. The product has several decorations and is available in different colour combinations. The hood includes drawstring with free ends. Sizes of the samples: 98, 110, 122, 128

Country of origin:
Unknown

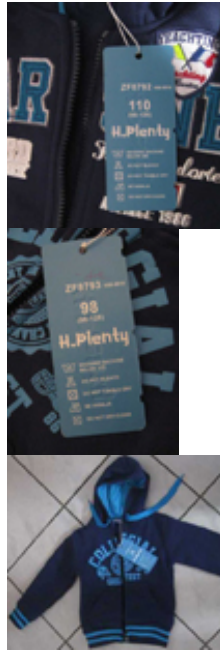

The product does not comply with the relevant European standard EN 14682.

| | | | | | | | |
|---------------------|--------------------------|---------------------------|----------------|--|--|--|--|
| <p>Serious risk</p> | <p>Consumer products</p> | <p>28 A12/1767/14</p> | <p>Hungary</p> | <p>Category: Communication and media equipment</p> <p>Product: Portable radio</p> <p>Brand: LEOTEC</p> <p>Name: Obsessed With Sound</p> <p>Type/number of</p> | <p>Electric shock</p> <p>The product poses a risk of electric shock because: - the soldered wire connections at mains voltage are not mechanically secured and</p> | <p>Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users</p> | |
|---------------------|--------------------------|---------------------------|----------------|--|--|--|--|

model: LT-Q2

Batch number/Barcode:
2010101600021

OECD Portal Category: 68000000 - Audio Visual / Photography

Description:
FM/MW/SW portable radio, made of black and silver plastic with a telescopic metal antenna. The radio operates both on mains and batteries (UM-1). Dimensions of product: 7 cm x 17 cm x 12 cm Technical parameters: AC 220V / 50Hz; DC 3V (UM-1 x 2); IP20; CLASS II. The product is supplied in colourful cardboard box.

Country of origin:
China



can thus become free; - the terminals of the plug inside the product casing unit can be touched; - the live parts of the mains cable can be touched since the dimensions of the socket outlet and the flat plug are not suitable.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60065.

| | | | | | | | |
|---------------------|--------------------------|---------------------------|-----------------|--|---|--|--|
| <p>Serious risk</p> | <p>Consumer products</p> | <p>29 A12/1768/14</p> | <p>Bulgaria</p> | <p>Category: Clothing, textiles and fashion items Product: Girls' dress Brand: Bupper Name: Unknown Type/number of model: K-806 Batch number/Barcode: 3637454000064</p> | <p>Injuries The functional cords in the waist area can become trapped and cause injuries. The product does not comply with the relevant European standard EN 14682.</p> | <p>Compulsory measures: Ban on the marketing of the product and any accompanying measures</p> | |
|---------------------|--------------------------|---------------------------|-----------------|--|---|--|--|

OECD Portal



Category: 67000000 - Clothing

Description: Girls' dress in purple colour, designed and produced with a white, knitted functional cord in the waist area, intended to be tied on the front, with free ends, each of which is about 20 cm long. There are textile labels attached.

Country of origin: Turkey



| | | | | | | | |
|---------------------|--------------------------|---------------------------|-----------------|---|--|--|--|
| <p>Serious risk</p> | <p>Consumer products</p> | <p>30 A12/1769/14</p> | <p>Bulgaria</p> | <p>Category: Clothing, textiles and fashion items</p> <p>Product: Girls' dress</p> <p>Brand: VESTITO</p> <p>Name: Unknown</p> <p>Type/number of model: Unknown</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 67000000 - Clothing</p> <p>Description: Girls' short-sleeved dress, with an attached ribbon on the front of the belt, with 6 attached transparent rhinestones. The dress is white with</p> | <p>Injuries</p> <p>The product has a long tie belt, to be tied at the back of the garment, which can become trapped during various activities of a child.</p> <p>The product does not comply with the relevant European standard EN 14682.</p> | <p>Compulsory measures: Ban on the marketing of the product and any accompanying measures</p> | |
|---------------------|--------------------------|---------------------------|-----------------|---|--|--|--|

| | | | | | | | |
|--------------|-------------------|-------------------|----------|---|--|--|--|
| | | | | <p>pink embroidered pattern.</p> <p>Country of origin: Turkey</p>  | | | |
| Serious risk | Consumer products | 31 A12/1770/14 | Bulgaria | <p>Category: Clothing, textiles and fashion items</p> <p>Product: Children's overalls</p> <p>Brand: ÖYKÜM</p> <p>Name: Unknown</p> <p>Type/number of model: Unknown</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 67000000 - Clothing</p> <p>Description: Children's overalls, in white colour with small flowers, with a textile flower attached to the front and glued decorative pearls.</p> <p>Country of origin: Turkey</p>  | <p>Injuries, Strangulation</p> <p>The product has functional cords in the neck area, with free ends to be tied at the back that may become caught and the child may be strangled or injured. The product does not comply with the relevant European standard EN 14682.</p> | <p>Compulsory measures: Ban on the marketing of the product and any accompanying measures</p> | |
| Serious risk | Consumer products | 32 A12/1771/14 | Cyprus | <p>Category: Clothing, textiles and fashion items</p> | <p>Strangulation</p> <p>The long functional</p> | <p>Compulsory measures: Withdrawal of the product</p> | |

Product: Children's sweatshirt
Brand: Champion
Name: Unknown
Type/number of model: Style: 402568

Batch number/Barcode:
8055357193518

OECD Portal Category: 67000000 - Clothing

Description: Light blue sweatshirt intended for children of 7-8 years. The sweatshirt has functional cords of approximately 9cm in the neck area.

Country of origin:
Cambodia



cords in the neck area can become trapped during various activities of a child, causing strangulation.

The product does not comply with the relevant European standard EN 14682.

from the market

| | | | | | | | |
|--------------|-------------------|-------------------|----------|---|---|--|--|
| Serious risk | Consumer products | 33 A12/1772/14 | Bulgaria | <p>Category: Clothing, textiles and fashion items</p> <p>Product: Children's cardigan</p> <p>Brand: CITIR</p> <p>Name: Unknown</p> <p>Type/number of model: Unknown</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 67000000 - Clothing</p> <p>Description: Children's cardigan, mechanically knitted, with attached flowers on the front, white in</p> | <p>Injuries</p> <p>The product has functional cords in the waist area which can become trapped during various activities of a child.</p> <p>The product does not comply with the relevant European standard EN 14682.</p> | <p>Compulsory measures: Ban on the marketing of the product and any accompanying measures</p> | |
|--------------|-------------------|-------------------|----------|---|---|--|--|

colour.

Country of origin:
Turkey



Serious risk

Consumer products

34
A12/1773/14

Bulgaria

Category: Clothing, textiles and fashion items

Product: Children's clothing set

Brand: Rozalinda

Name: Baby and Kids

Type/number of model: Unknown

Batch number/Barcode: Unknown

OECD Portal Category: 67000000 - Clothing

Description: Children's set made of a sweatshirt and trousers, mainly orange, with several decorations. Size of the sample: 74.

Country of origin:
Turkey




Injuries, Strangulation

The top has functional cords to be tied at the back of the neck area, this may cause strangulation and injuries to children.

The product does not comply with the relevant European standard EN 14682.

Compulsory measures: Ban on the marketing of the product and any accompanying measures

| | | | | | | | |
|--------------|-------------------|-------------------|----------|--|---|--|--|
| Serious risk | Consumer products | 35 A12/1774/14 | Bulgaria | <p>Category: Clothing, textiles and fashion items</p> <p>Product: Girls' dress</p> <p>Brand: Yakkonis</p> <p>Name: Unknown</p> <p>Type/number of model: Unknown</p> <p>Batch number/Barcode: Unknown</p> <p>OECD Portal Category: 67000000 - Clothing</p> <p>Description: Orange and white dress for girls, with ribbon/belt. The product is intended for girls up to two years of age.</p> <p>Country of origin: Turkey</p>  | <p>Injuries</p> <p>The long belt attached to the waist can become trapped and cause injuries to the child.</p> <p>The product does not comply with the relevant European standard EN 14682.</p> | <p>Compulsory measures: Ban on the marketing of the product and any accompanying measures</p> | |
| Serious risk | Consumer products | 36 A12/1775/14 | France | <p>Category: Childcare articles and children's equipment</p> <p>Product: Folding chair for children</p> <p>Brand: John</p> <p>Name: Disney Princess</p> <p>Type/number of model: Ref. No 73111-96830</p> <p>Batch number/Barcode: Lot: 608504, 4 006149090205</p> <p>OECD Portal Category: 54000000 - Baby Care</p> <p>Description: Folding chair for children supplied in pink cardboard boxes.</p> <p>Country of origin: Unknown</p> | <p>Choking, Injuries</p> <p>A small plastic part of the chair's feet can easily come off. Since the chair is likely to be accessible to small children, they could put such small parts in their mouth and choke.</p> <p>The locking mechanism is defective, the folding device is fragile and the space between the textile of the back and its supporting tube is too large. All these defects could lead to injuries.</p> <p>The product</p> | <p>Voluntary measures: Withdrawal of the product from the market</p> | |



does not comply with the relevant national standard.

| | | | | | | | |
|--------------|-------------------|-------------------|---------|--|---|---|--|
| Serious risk | Consumer products | 37 A12/1776/14 | Germany | <p>Category: Motor vehicles</p> <p>Product: Passenger car</p> <p>Brand: VW</p> <p>Name: Polo</p> <p>Type/number of model: Type: 6R1 – type approval: e1*2001/116*0510*</p> <p>Batch number/Barcode: Vehicles produced between 3 July 2009 and 25 April 2014 are affected.</p> <p>OECD Portal Category: 77000000 - Automotive</p> <p>Description: Passenger car.</p> <p>Country of origin: Germany</p> <p>No pictures are available</p> | <p>Injuries</p> <p>Owing to pressure pulsations occurring in the fuel lines and engine vibrations during operation, vibration may be transmitted to the diesel fuel filter cover. This may lead to a fatigue crack on the filter cover in the area of the inlet fitting and the possibility of a diesel fuel leak. This can lead to a traffic hazard.</p> | <p>Voluntary measures: Recall of the product from end users</p> | |
| Serious risk | Consumer products | 38 A12/1777/14 | France | <p>Category: Hobby/sports equipment</p> <p>Product: Mountain bike</p> <p>Brand: BIKE SPORT</p> <p>Name: Runner - VTT 24" tout suspendu garçon (full suspension boys)</p> <p>Type/number of model: Mountain bike reference: 13H-DS4013-21; Mountain bike model: FULL SUSPENSION BOYS' RUNNER; Fork reference: CH 327 E EN 24' ;</p> <p>Batch number/Barcode: Batch of mountain bikes: BG2013 10</p> | <p>Injuries</p> <p>The steerer tube is not strong enough and may break which could lead to the cyclist falling off.</p> <p>The product does not comply with the relevant European standard EN 14766.</p> | <p>Voluntary measures: Withdrawal of the product from the market, Recall of the product from end users</p> | |

062; Fork batch:
FK2785; Barcode:
3700585504852;

OECD Portal
Category: 71000000 -
Sports Equipment

Description:
Mountain bike 24
inches (children) matt
white, delivered to
retailers 85% pre-
assembled in boxes of
129/21-60 cm / weight
19.6 kg.

Country of origin:
Bulgaria



Other
risk
level

Consumer
products

39
A11/0096/14

Finland

Category: Machinery

Product: Trolley jack

Brand: Tamforce

Name: Hydraulic
trolley jack

**Type/number of
model:** LC22001,
127-330 mm, 2000 kg

**Batch
number/Barcode:**
Serial number:
kl11307005155, EAN-
code: 64328410221

OECD Portal
Category: 82000000 -
Tools / Equipment -
Power

Description: Trolley
jack. red frame,
standing on 4 black
plastic wheels.

Country of origin:
China



Injuries

The jack, when
it is loaded with
the rated load,
lowers too fast
and in an
uncontrolled
manner which
could lead to
the user being
injured.

The product
does not
comply with the
requirements
of the
Machinery
Directive and
the relevant
European
standard EN
1494.

**Voluntary
measures:**
Withdrawal of
the product
from the
market



| | | | | | | | |
|------------------|-------------------|-------------------|---------|---|---|--|--|
| Other risk level | Consumer products | 40 A11/0097/14 | Finland | <p>Category: Machinery</p> <p>Product: Trolley jack</p> <p>Brand: Motoral</p> <p>Name: 2000 kg Hallinosturi</p> <p>Type/number of model: Mplus 2000, TA820012, 50644020, 135-330 mm</p> <p>Batch number/Barcode: Serial number: 2013007965, EAN 6417196620563</p> <p>OECD Portal Category: 82000000 - Tools / Equipment - Power</p> <p>Description: Trolley jack with black frame, standing on 4 black plastic wheels.</p> <p>Country of origin: China</p> | <p>Injuries</p> <p>The jack, when it is loaded with the rated load, lowers too fast and in an uncontrolled manner which could lead to the user being injured.</p> <p>The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1494.</p> | <p>Compulsory measures: Withdrawal of the product from the market</p> | |
|------------------|-------------------|-------------------|---------|---|---|--|--|

